


GAUMONT-KALEE

SOUND & PROJECTION EQUIPMENT

SPARE PARTS LIST FOR

MOLE SUPER 70 ARC LAMP

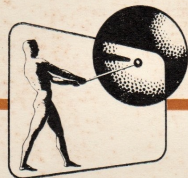


RANK PRECISION INDUSTRIES LTD.

GAUMONT-KALEE DIVISION



37-41 Mortimer Street, London W.1, England

Telephone : Museum 5432

Cables : 'RANKALEE LONDON'

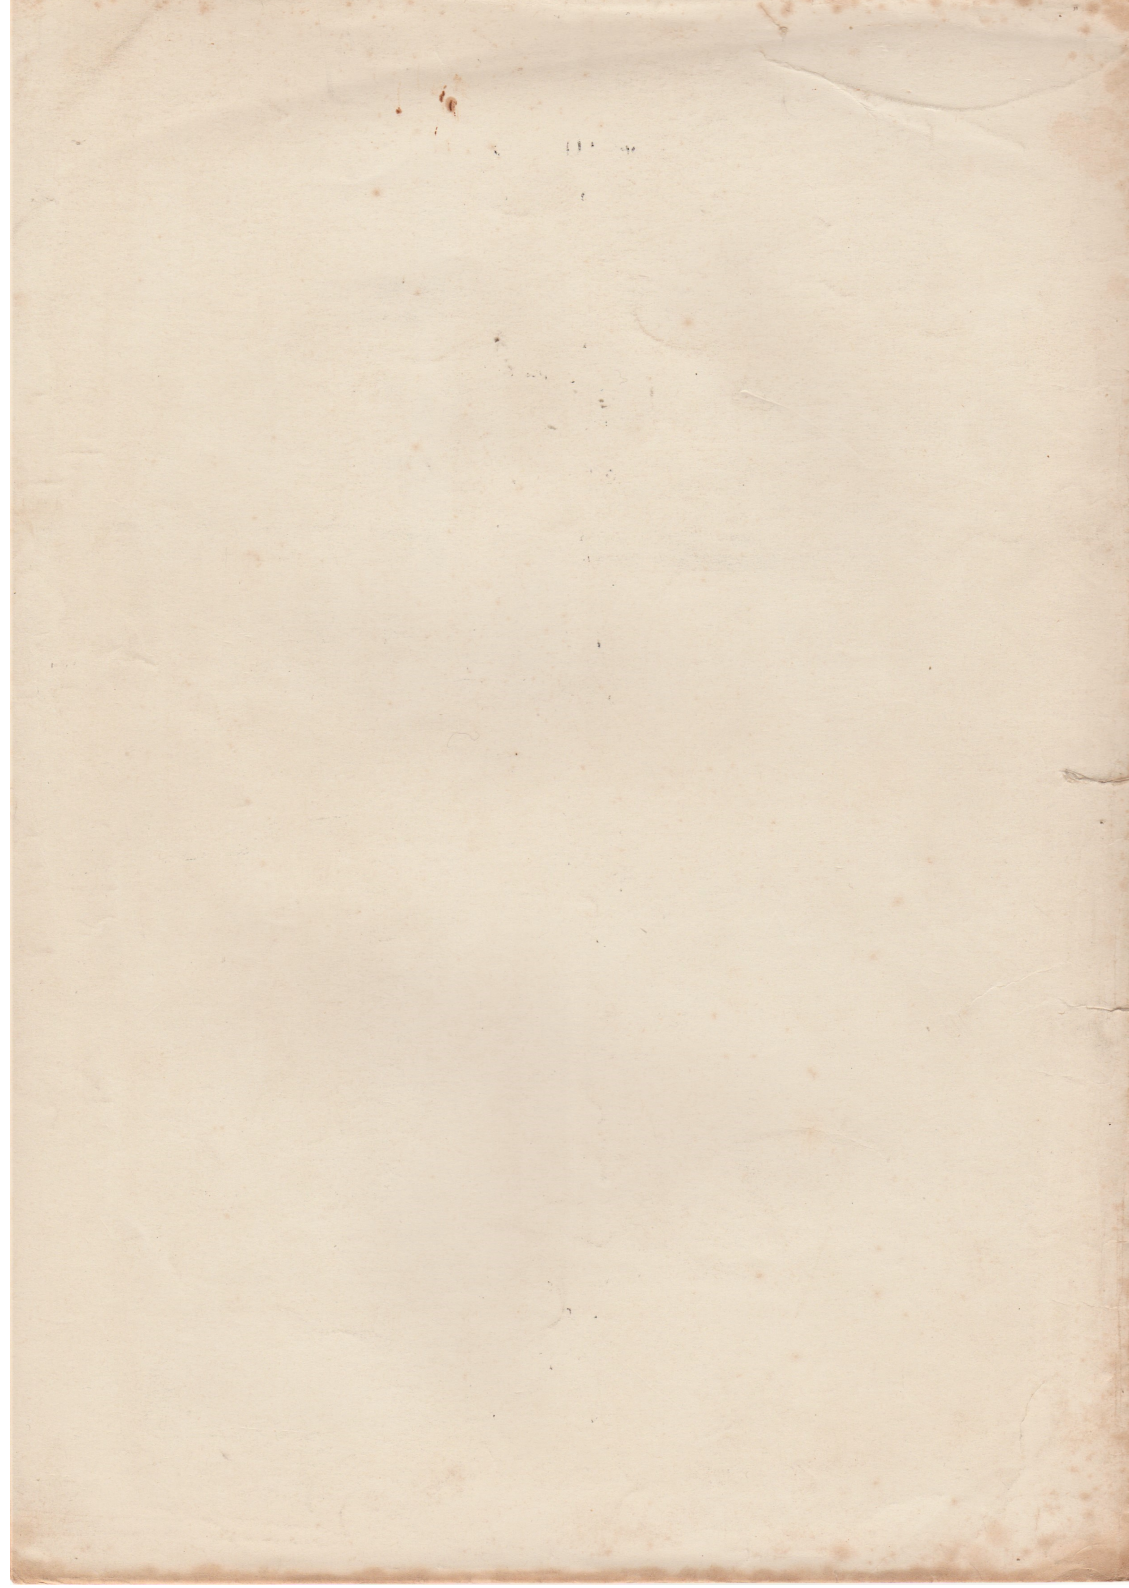

THE
GAUMONT-KALEE
MOLE-RICHARDSON
SPARE-PARTS CATALOGUE
FOR
"SUPER 70" ARC-LAMP

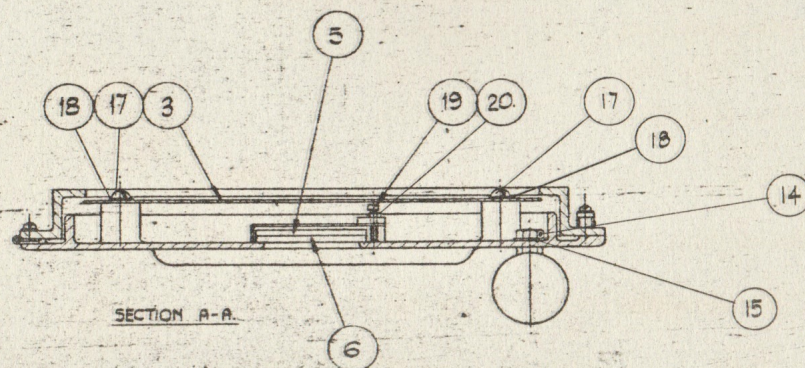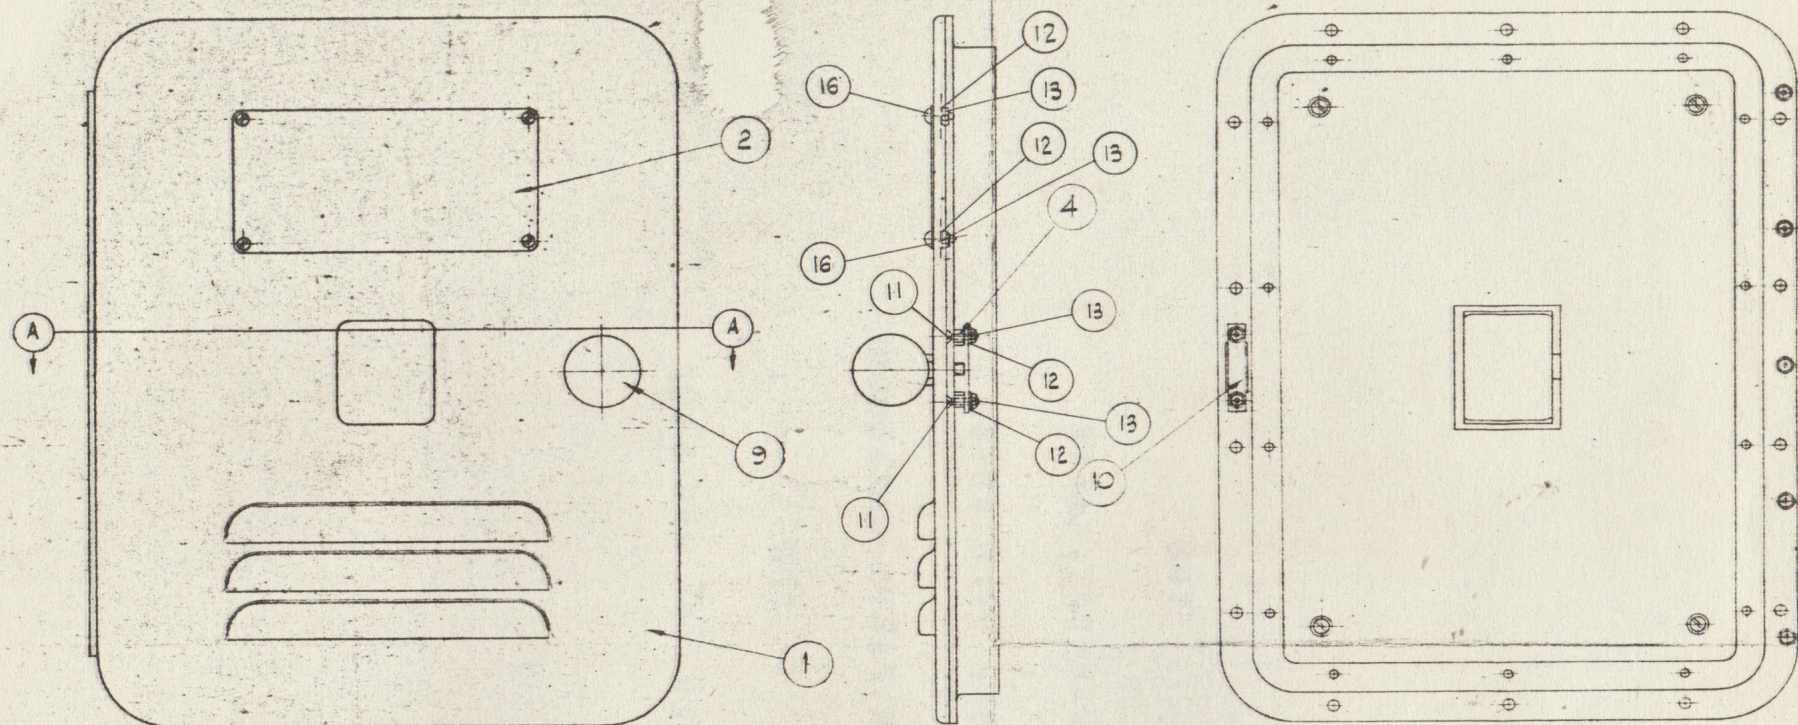


C 505 - AH.

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

REAR DOOR ASSEMBLY (DRAWING NO. C.505-AH)

Item	Drg. No.	Part	Quantity
1	C. 505-AG	Rear Door Assembly.	1
2	490-248	Rear Door Nameplate.	1
3	A. 505-171	Rear Door Baffle.	1
4	A. 505-207	Door-latch Spacer	2
5	490-330	Heat-resisting Peephole Glass.	1
6	490-331	Dark Peephole Glass.	1
9	Stock	Door-knob	1
10	"	Doorlatch, female half.	1
11	"	Countersunk-head screws, securing item 10.	2
12	"	Shakeproof washers; (2 for door-latch screws; 4 for nameplate screws).	6
13	"	Nuts, retaining; (2 for door-latch, 4 for nameplate screws).	6
14	"	Hexagon-head bolt, securing door-knob.	1
15	"	Washer for item 14.	1
16	"	Roundhead screws securing nameplate.	4
17	"	Roundhead screws securing rear door baffle.	4
18	"	Washers for item 17	4
19	"	Cheesehead screw, securing peephole glasses.	1
20	"	Locknut for item 19.	1


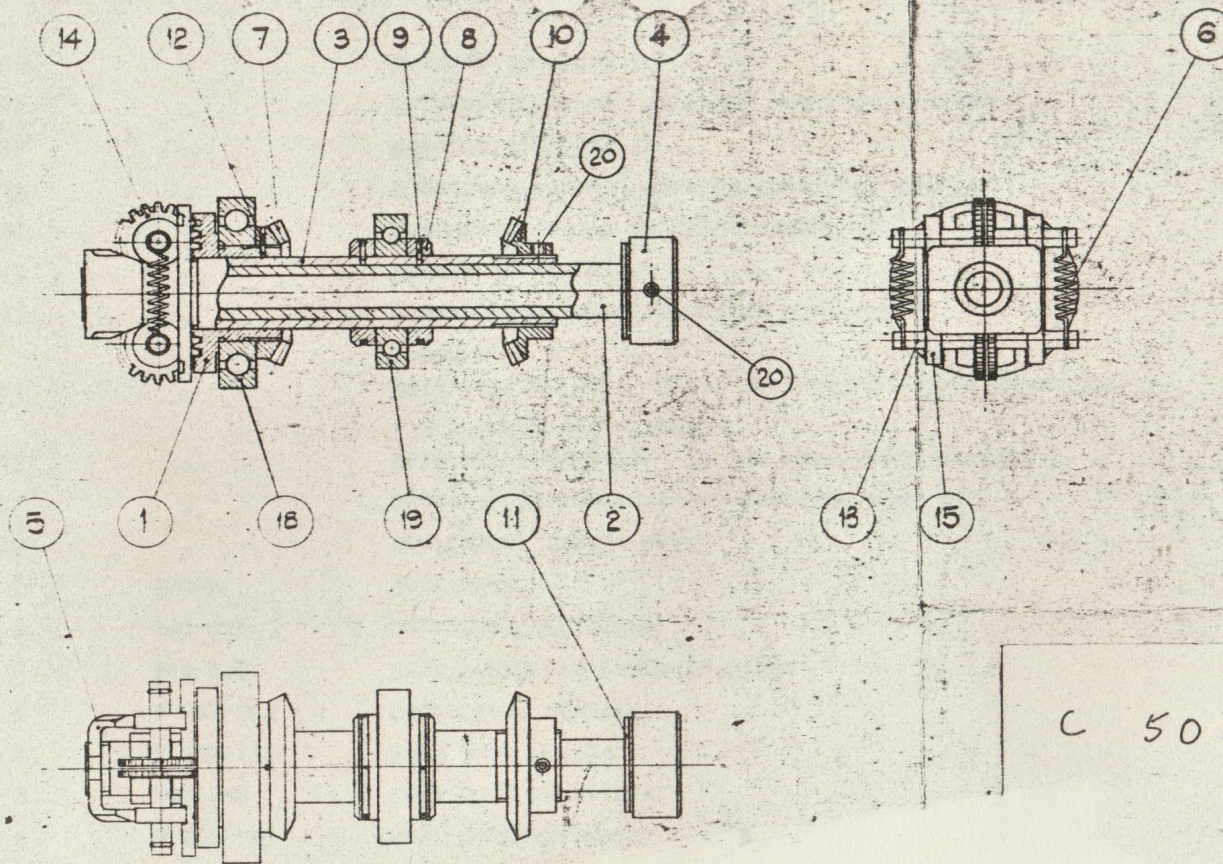


C 505-AL

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

ROTAR ASSEMBLY (DRAWING NO. C.505-AL)

Item	Drg. No.	Part	Quantity
1	490-19	Carbon feed Scroll.	1
2	A. 505-42	Carbon release tube.	1
3	A. 505-43	Positive Rotor	1
4	490-22	Carbon release nut.	1
5	490-23	Carbon release wedge.	1
6	490-25	Carbon feed spring.	2
7	490-27	Bevel Gear.	1
8	490-28	Locking Ring.	2
9	490-29	Locking spring.	2
10	490-30	Rotor Bevel Gear.	1
11	490-137	Facing washer.	1
12	490-506	Retaining clip.	1
13	90-7A	Carbon feed Gear Shaft.	2
14	90-9	Carbon feed Gear.	2
15	90-160	Release roller	4
18	Stock	Bearing, 1".	1
19	"	Bearing, 3/4".	1
20	"	Grubscrews, securing items 4 & 10.	2

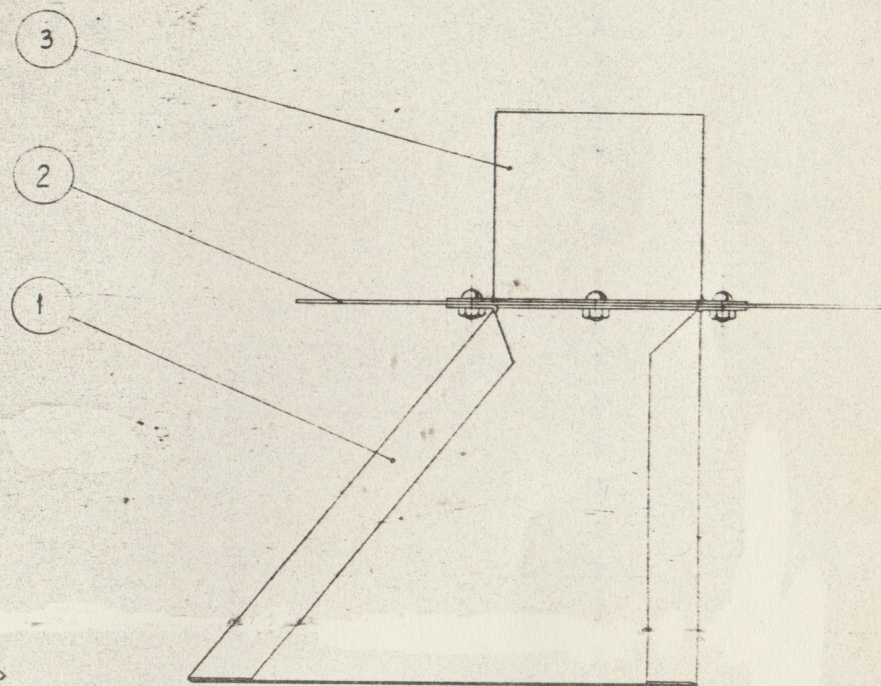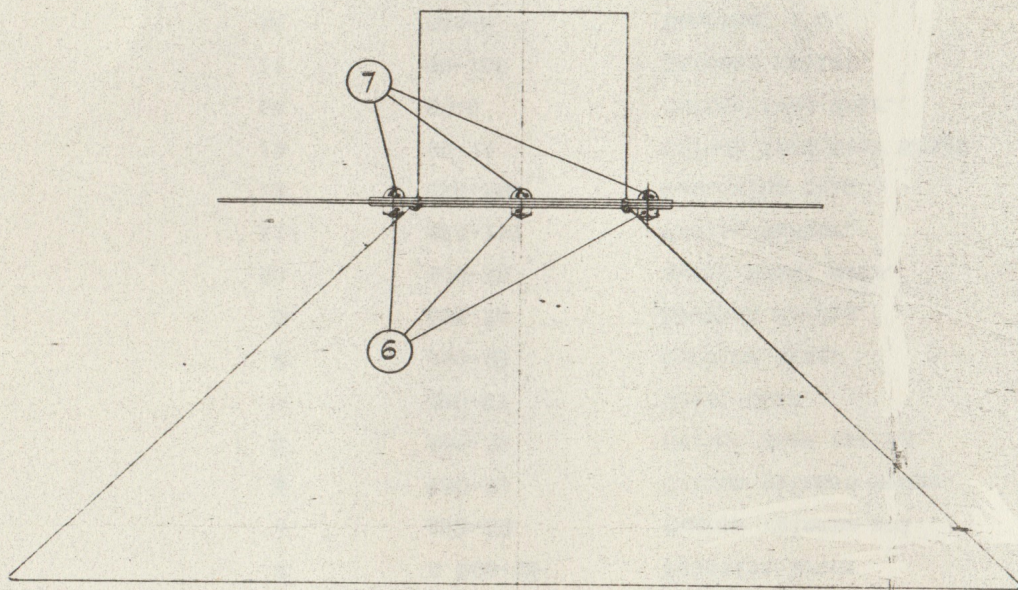


C 505 - A U.

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

FLAME FUNNEL ASSEMBLY (DRAWING NO. C.505-AU)

Item	Drg. No.	Part	Quantity
1	C.505-222	Flame funnel skirt.	1
2	B.505-223	Flame funnel Fixing plate.	1
3	B.505-221	Flame funnel.	1
6	Stock	Roundhead screws securing items 1, 2 & 3.	4
7	"	Nuts for item 6.	4

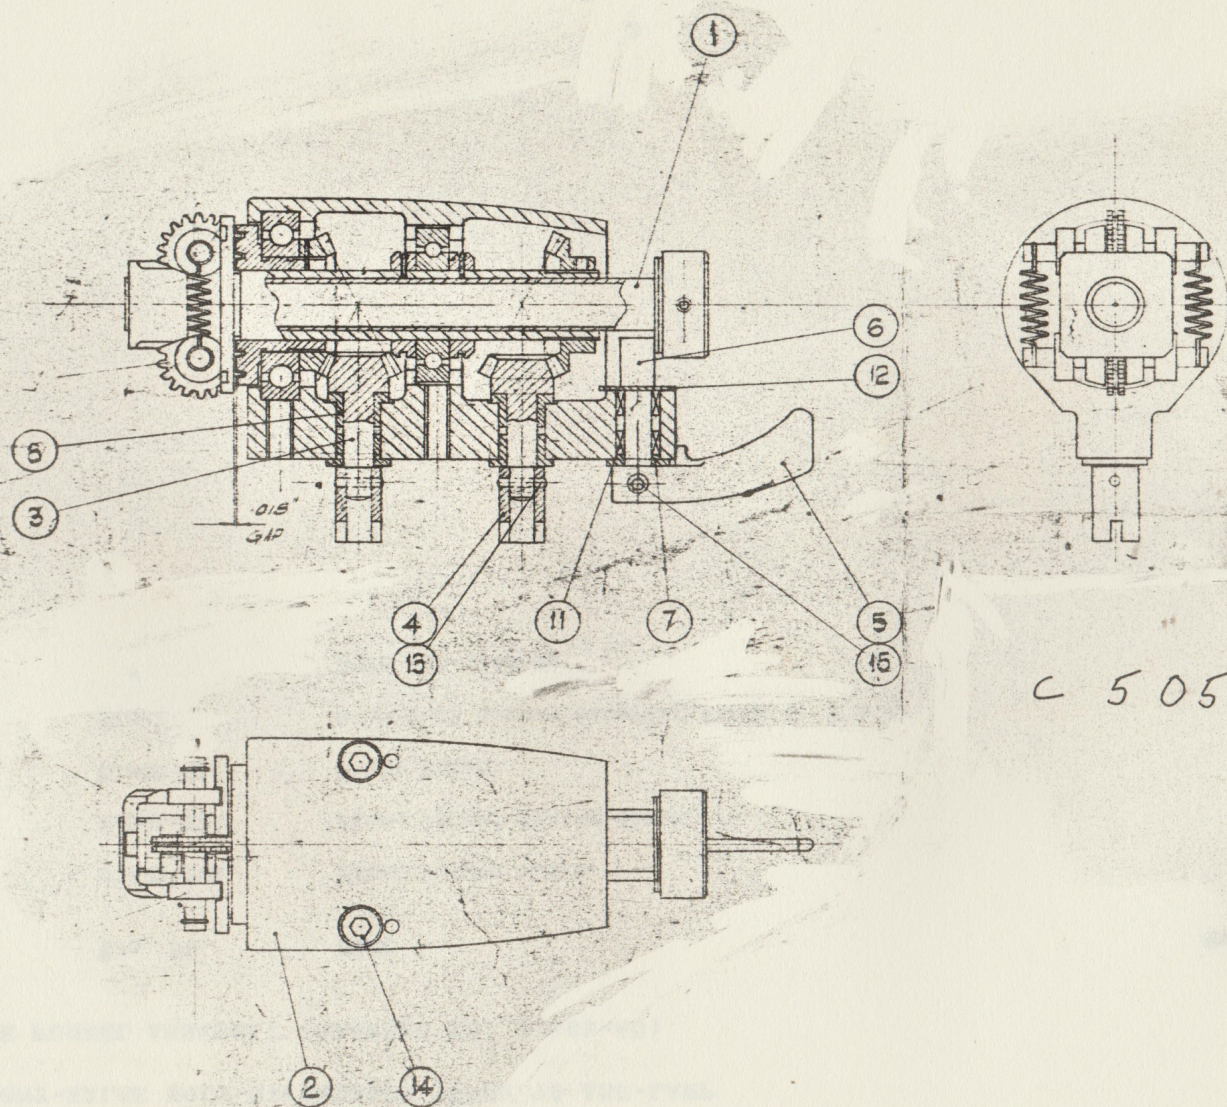


C 505-B


GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

POSITIVE HEAD ASSEMBLY (DRAWING NO. C.505-B)

Item	Drg. No.	Part	Quantity
1	C.505-AL	Rotor Assembly	1
2	C.505-182	Positive Head casting.	1
3	A.505-44	Rotor bevel Pinion.	2
4	490-31	Drive Bush.	2
5	A.505-47	Carbon release lever.	1
6	A.505-48	Carbon release cam.	1
7	490-136	Spacing washer.	1
8	A.505-49	Special Bearing.	1
11	Stock	Needle bearing.	2
12	"	Plain washer.	1
13	"	Groove pin.	1
14	"	Cap screw.	2
15	"	Grubscrew.	1

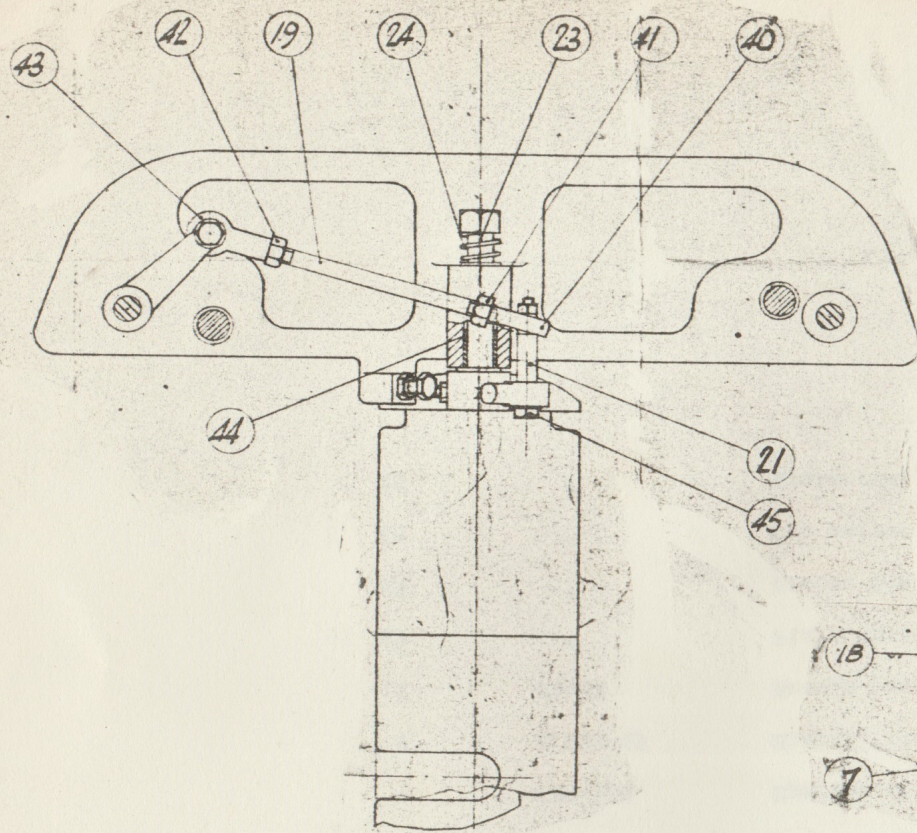


E 505-D
SECTION I

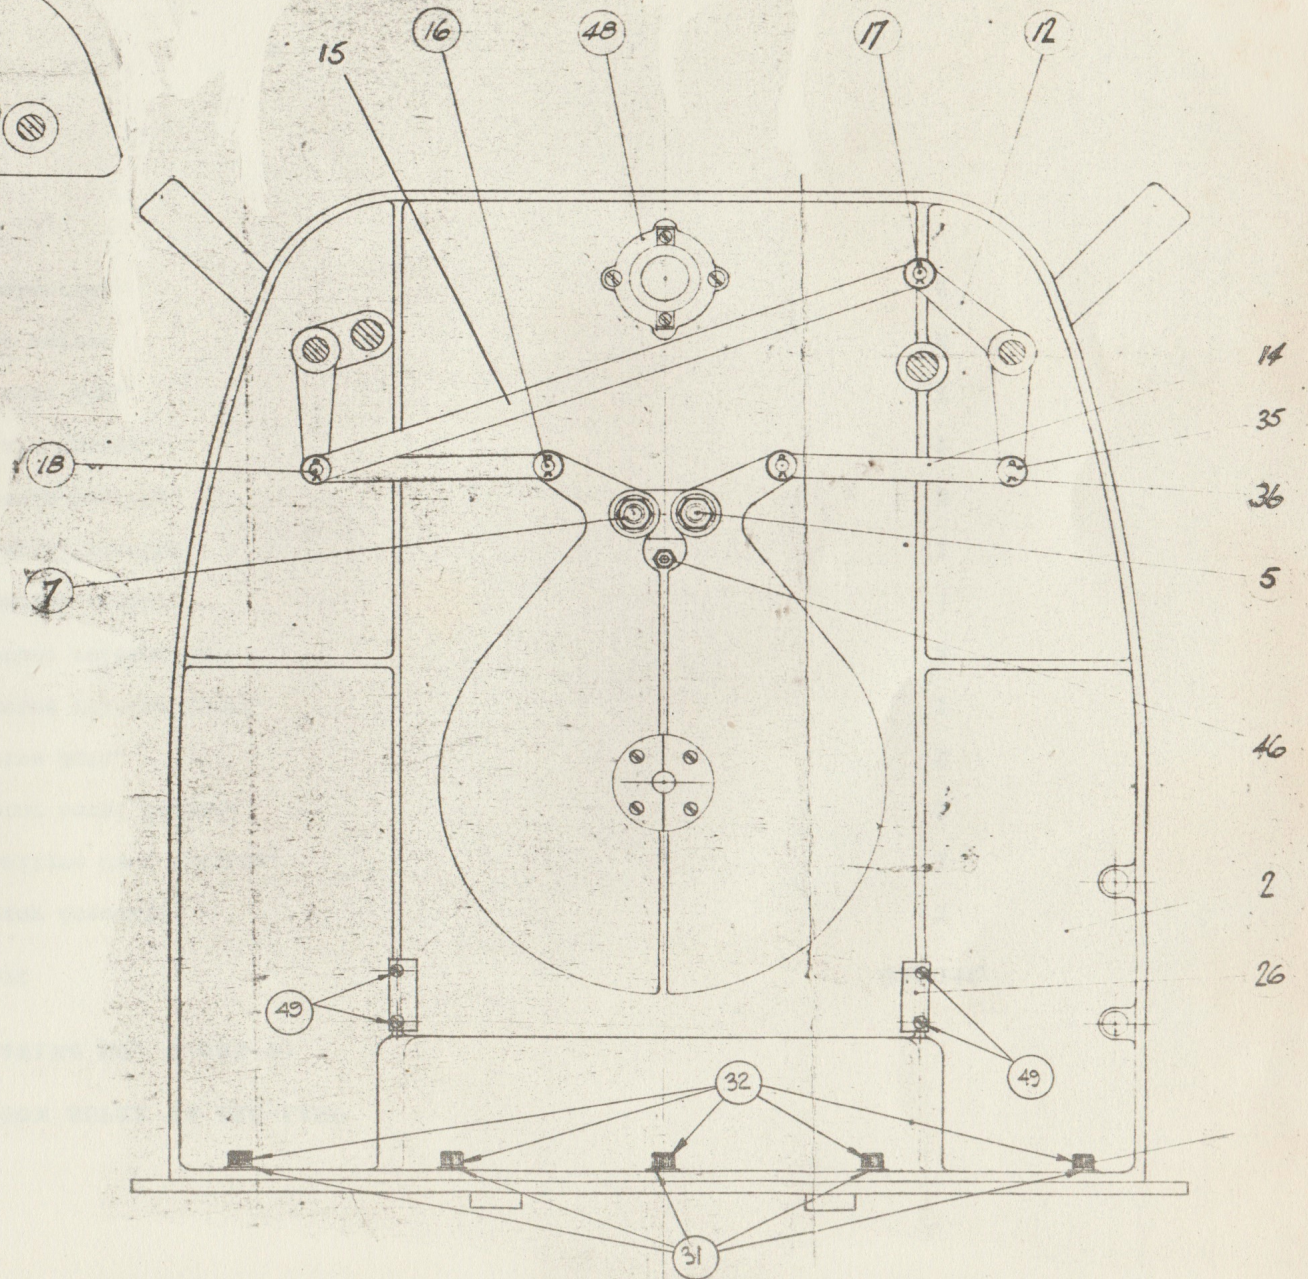

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

BASE & DOUSER ASSEMBLY (DRAWING NO. E.505-D, SECTION 1)

Item	Drg. No.	Part	Quantity
2	D.505-7	Front end Casting.	1
5	A.505-124	Douser Spindle.	2
7	A.505-131	Special nut, securing douser blade.	2
12	490-291	Front douser link.	4
14	A.505-56	Short Connecting Link.	2
15	A.505-57	Long Connecting Link.	1
16	A.505-132	Long douser link pin.	2
17	A.505-133	Short douser link pin.	2
18	A.505-134	Medium douser link pin.	1
19	A.490-649	Mirror guard Rod.	1
21	A.490-629	Connecting Pillar.	1
22	C.505-J	Mirror Guard Assembly.	1
23	490-630	Mirror Guard mounting spindle.	1
24	1450-517	Buffer Spring.	1
26	A.505-136	Filter Frame Support Plate.	2
27	B.505-68	Mirror Guard Blade.	1
28	B.505-67	Flame Guard.	1
31	Stock	Socket-head screws, securing baseplate.	5
32	"	Washers, for item 31.	5
35	"	Washers, for link-assemblies.	10
36	"	Split pins for link assemblies.	6
40	"	Nut, securing rod.	1
41	"	Rod end.	1
42	"	Nut, securing rod.	1
43	"	Rod end.	1
44	"	Oilite bush.	2
45	"	Bolt.	1
46	"	Nut.	2
48	"	Lampholder.	1
49	"	Screws.	4

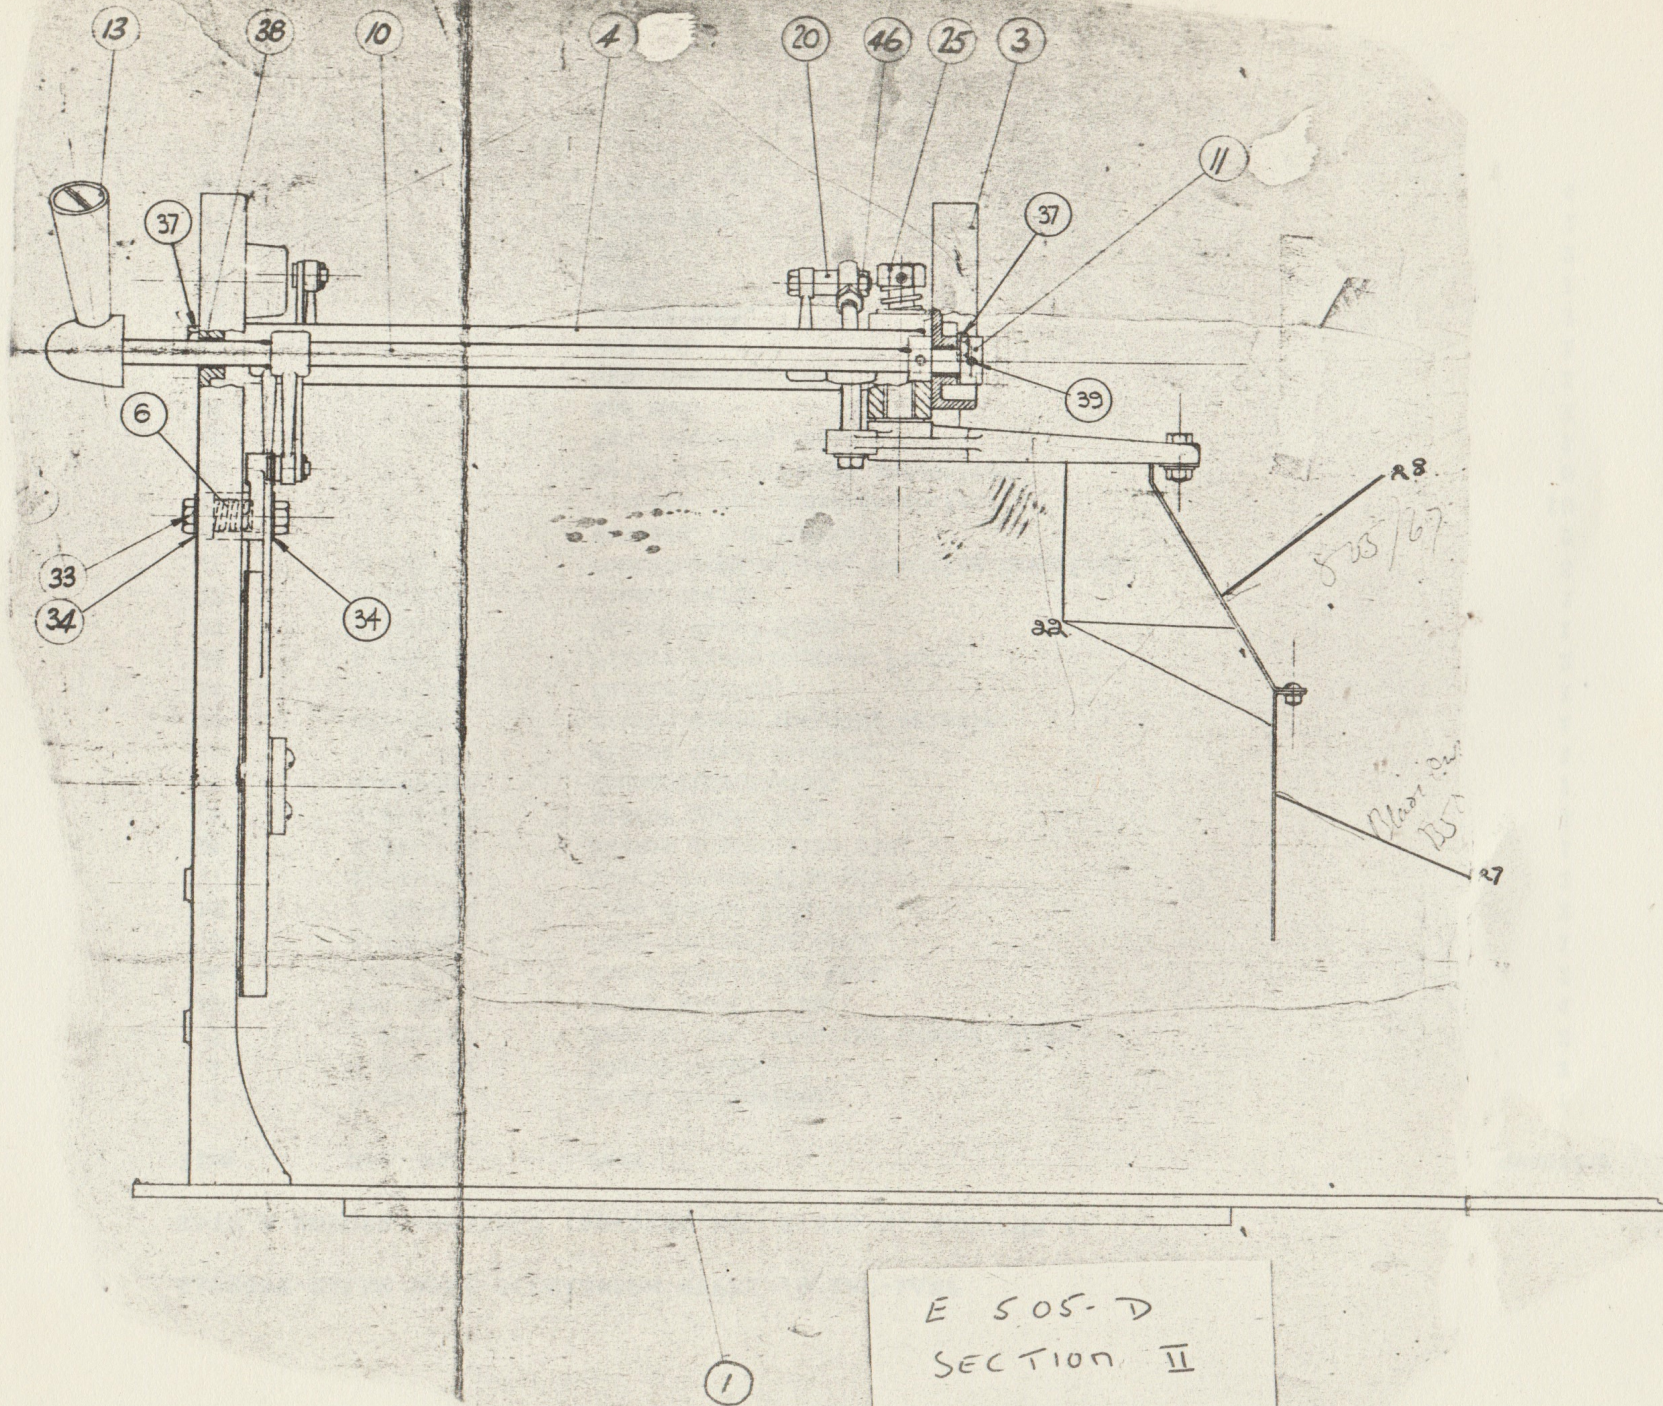

E 505-D
SECTION II



GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

BASE & DOUSER ASSEMBLY (DRAWING NO. E. 505-D, SECTION 2)

Item	Drg. No.	Part	Quantity
1	D.505-Z	Baseplate & rails Assembly.	1
3	D.505-8	Mirror guard Mounting casting.	1
4	B.505-59	Spacer Rod.	2
6	A.505-130	Douser Spring.	2
8	D.505-T	Douser blade Assembly, offside.	1 *
9	D.505-U	Douser blade Assembly, operating side.	1 *
10	B.505-60	Douser actuating Rod.	2
11	A.490-299	Douser shaft collar.	4
13	490-308	Sub-assembly of douser bosses.	2
20	A.905-574	Douser link, (threaded).	1
25	490-648	Special nut, securing spring.	1
33	Stock	Nut, securing douser blades.	2
34	"	Washers for item 33.	4
37	"	Bolt.	4
38	"	Oilite bush.	4
39	"	Grubscrew.	4
46	"	Nut securing douser link.	2

NOTE: * Items not annotated in drawing.


E 505 - E
SECTION I

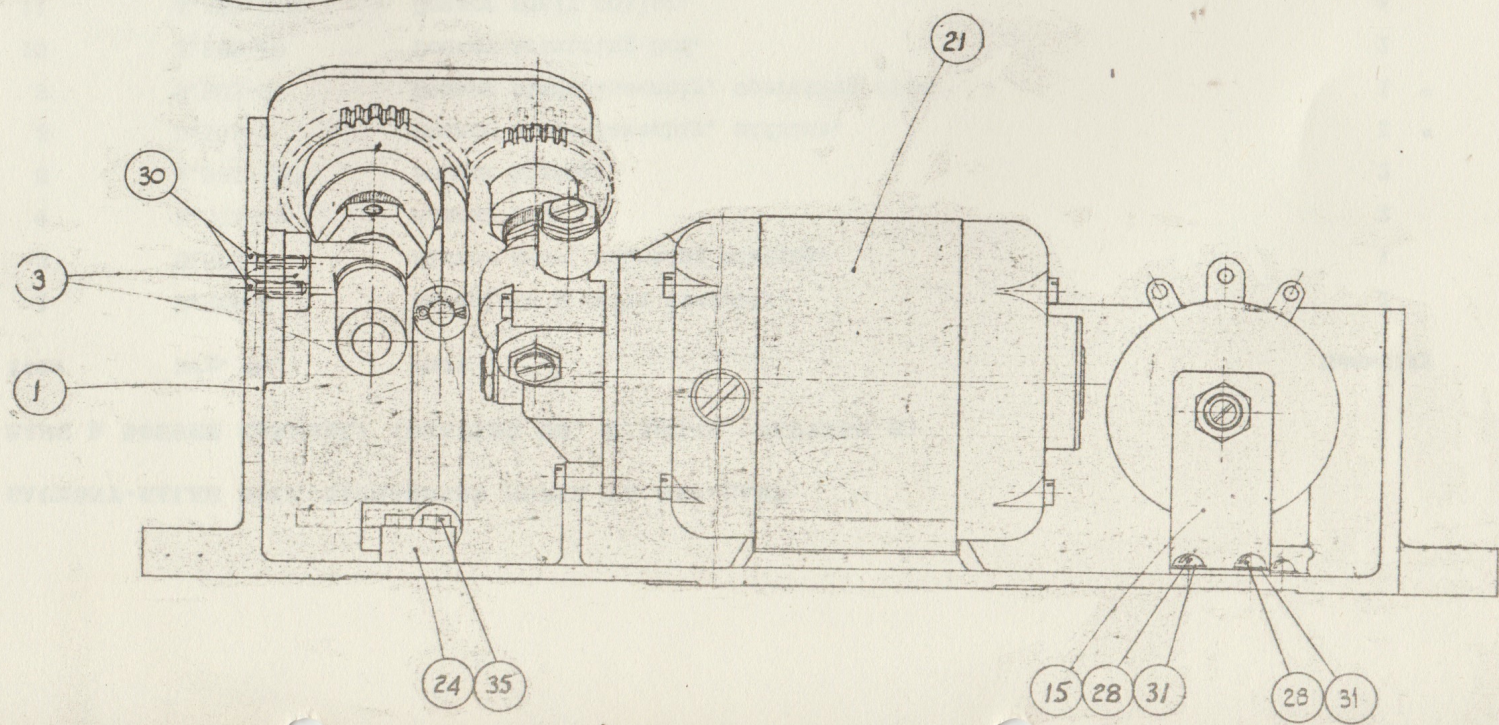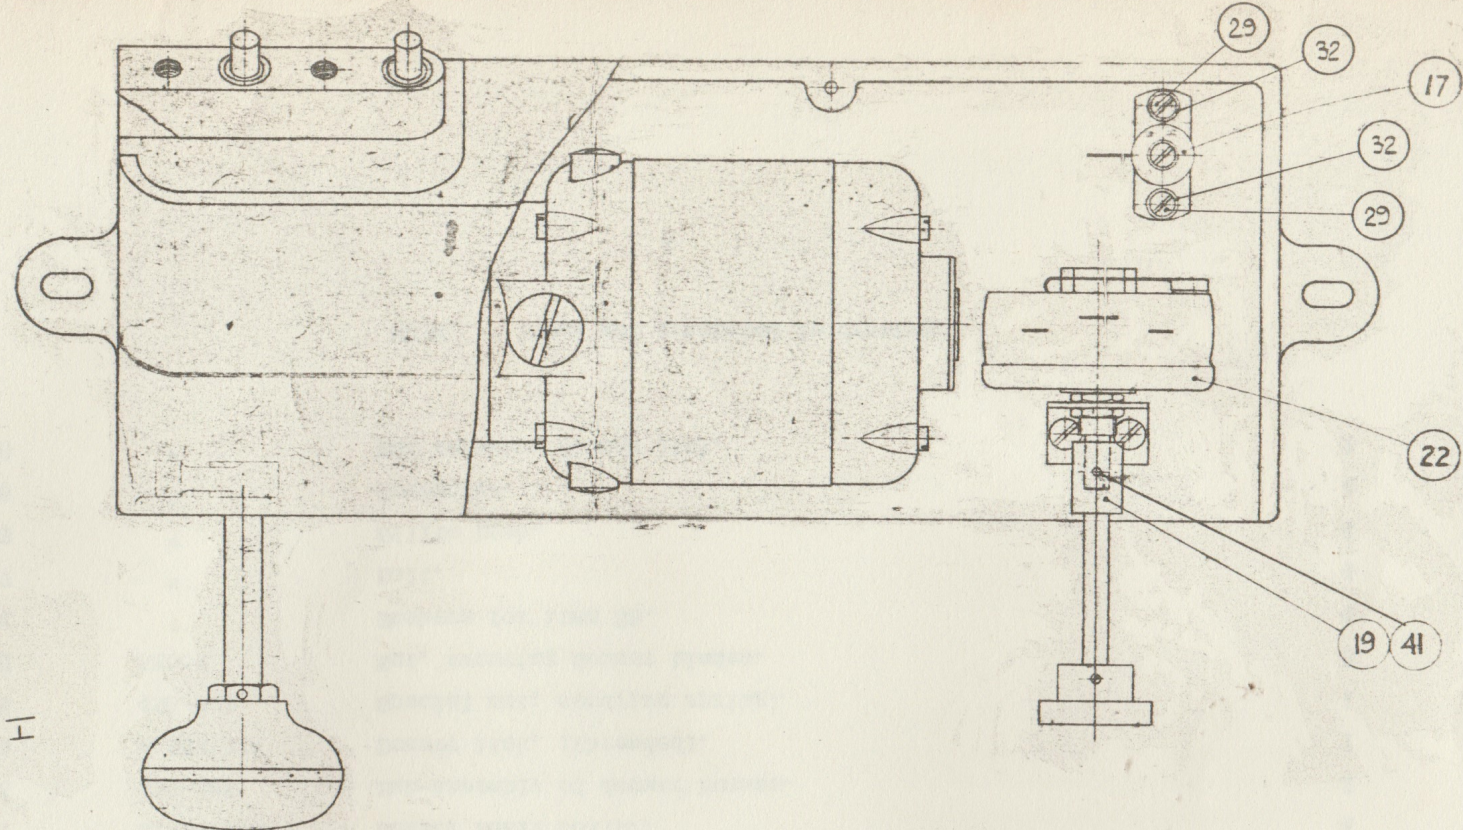


GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

DRIVE MOTOR BOX ASSEMBLY (DRAWING NO. E.505-E, SECTION 1)

Item	Drg. No.	Part	Quantity
1	D.505-6	Drive motor box.	1
3	A.505-10	Bearing bracket.	1
15	A.505-89	Rheostat bracket.	1
17	490-689	Resistance assembly.	1
19	A.505-170	Potentiometer spindle.	1
20	Spare number.		
21	Stock	Drive motor.	1
22	"	Rheostat.	1
24	"	Connector strip.	1
28	"	Roundhead screw, securing item 15.	2
29	"	Roundhead screw, securing item 17.	2
30	"	Countersunk head screw, securing item 3.	2
31	"	Shakeproof washers for item 28.	6
32	"	Shakeproof washers for item 29.	2
35	"	Cheese-head screw, securing item 24.	2
41	"	Groove pin, securing item 19.	1

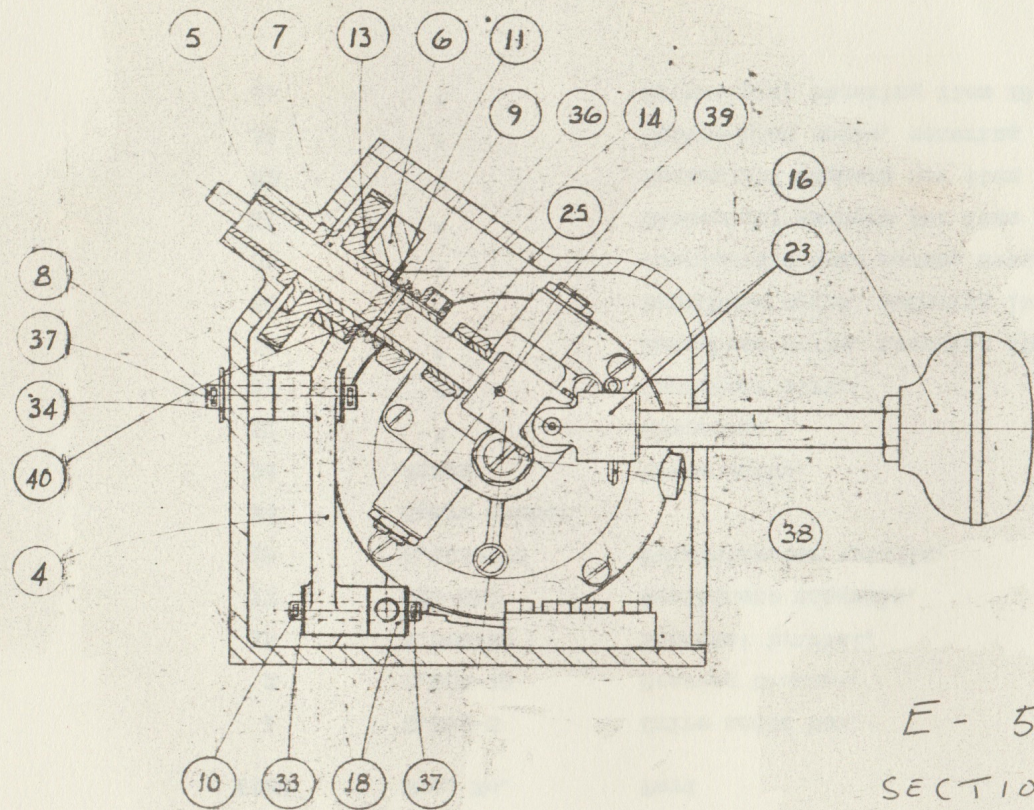



E-505-E
SECTION II

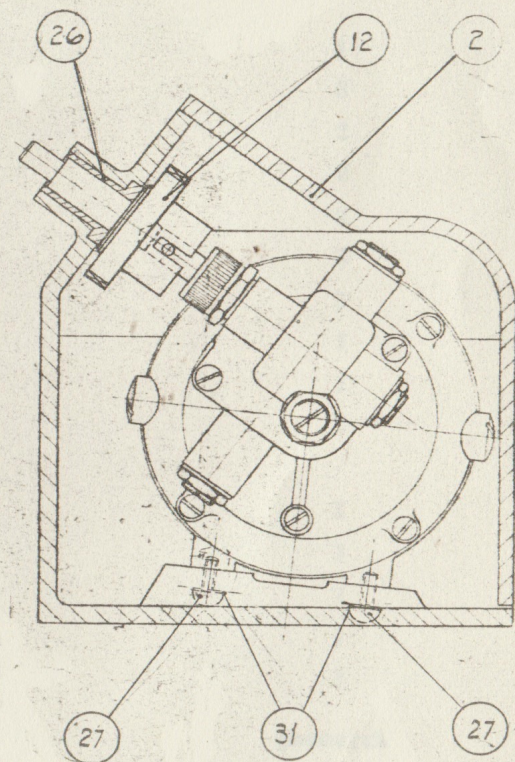

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

DRIVE MOTOR BOX ASSEMBLY (DRAWING NO. E.505-E, SECTION 2)


Item	Drg. No.	Part	Quantity
2	B.505-AC	Motor box cover assembly.	1
4	A.505-166	Negative feed lever.	1
5	A.505-33	Clutch spindle.	1
6	490-33	Negative feed cam.	1
7	A.505-31	Flanged clutch shaft.	1
8	A.505-163	Negative feed lever spindle.	1
9	A.505-87	Positive clutch spring.	1
10	A.505-164	Connecting pin.	1
11	A.505-162	Special washer.	1
12	A.505-213	Spur pinion.	1
13	A.505-212	Spur gear.	1
14	A.505-88	Adjusting nut.	1
16	A.505-H	Hand feed knob assembly.	1
18	A.505-153	Rod end.	1
23	Stock	Universal joint.	1
25	"	Oilite bush.	2
26	"	Oilite bush.	2
27	"	Roundhead screw securing item 21.	4
31	"	Shakeproof washers for item 27.	6
33	"	Plain washer for item 10.	2
34	"	Plain washer, small outside diameter.	1
36	"	Socket-head grubscrew.	1
37	"	Split pin.	4
38	"	Split pin for item 23.	1
39	"	Groove pin.	1
40	"	Groove pin.	1

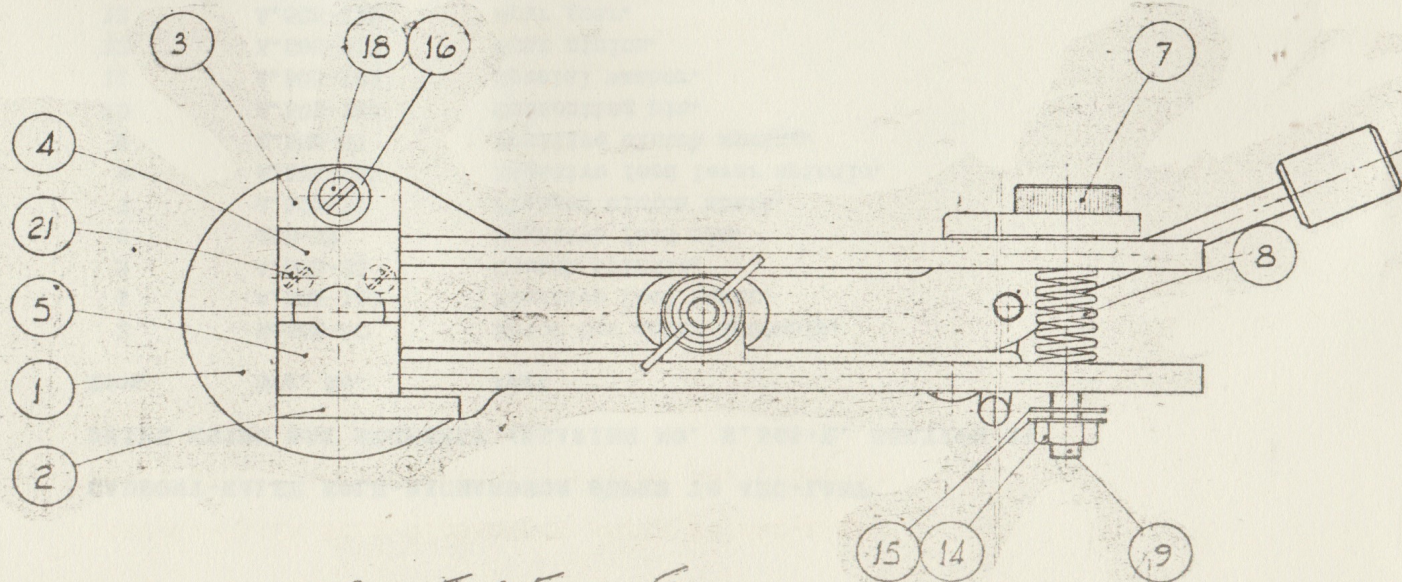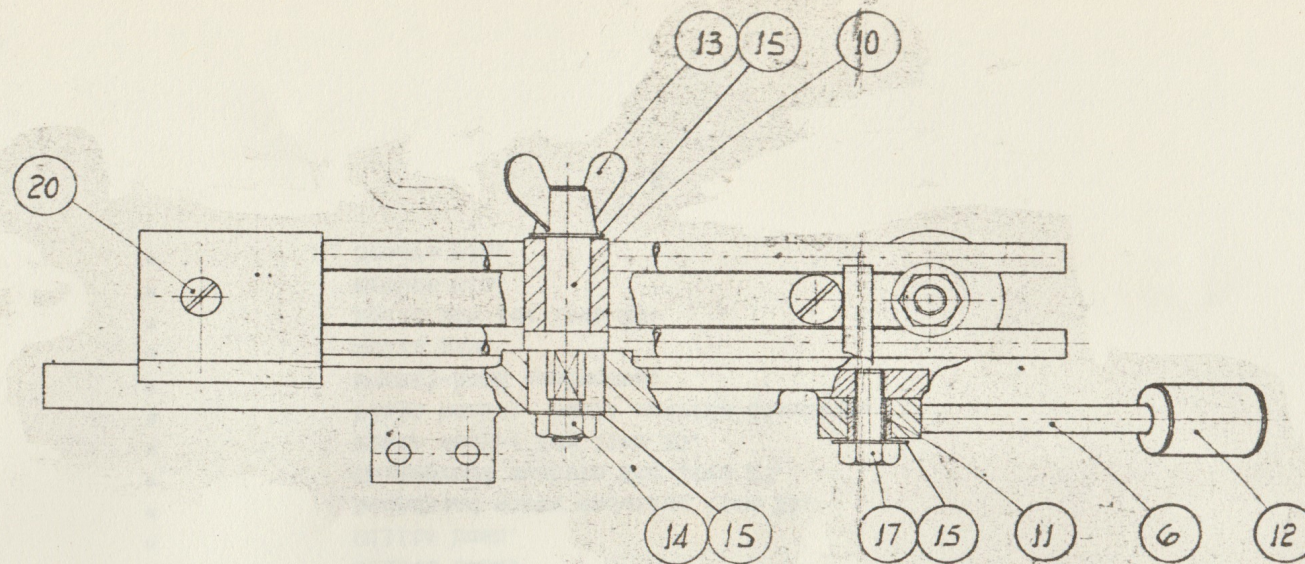


C 505 - F

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP
WATER-COOLED JAWS ASSEMBLY (DRAWING NO. C.505-F)

Item	Drg. No.	Part	Quantity
1	C.505-72	Fixed Silver holder.	1
2	B.505-73	Pivoted Silver holder.	1
3	A.505-74	Adjusting block.	1
4	A.505-K	Brazed jaw Assembly.	1
5	A.505-L	Brazed jaw Assembly.	1
6	A.505-AV	Contact release Assembly.	1
7	A.505-77	Spring Cap.	1
8	1450-469	Positive brush spring.	1
9	A.505-78	Spring location screw.	1
10	A.505-76	Silver holder pivot.	1
11	A.505-147	Spacer tube.	1
12	490-62	Negative release knob.	1
13	Stock	Wing nut.	1
14	"	Hexagonal nut, securing item 10.	2
15	"	Washer for item 14.	5
16	"	Washer for item 18.	1
17	"	Hexagonal-head screw.	1
18	"	Roundhead screw.	1
20	"	Countersunk-head screw.	1
21	"	Countersunk-head screw.	1

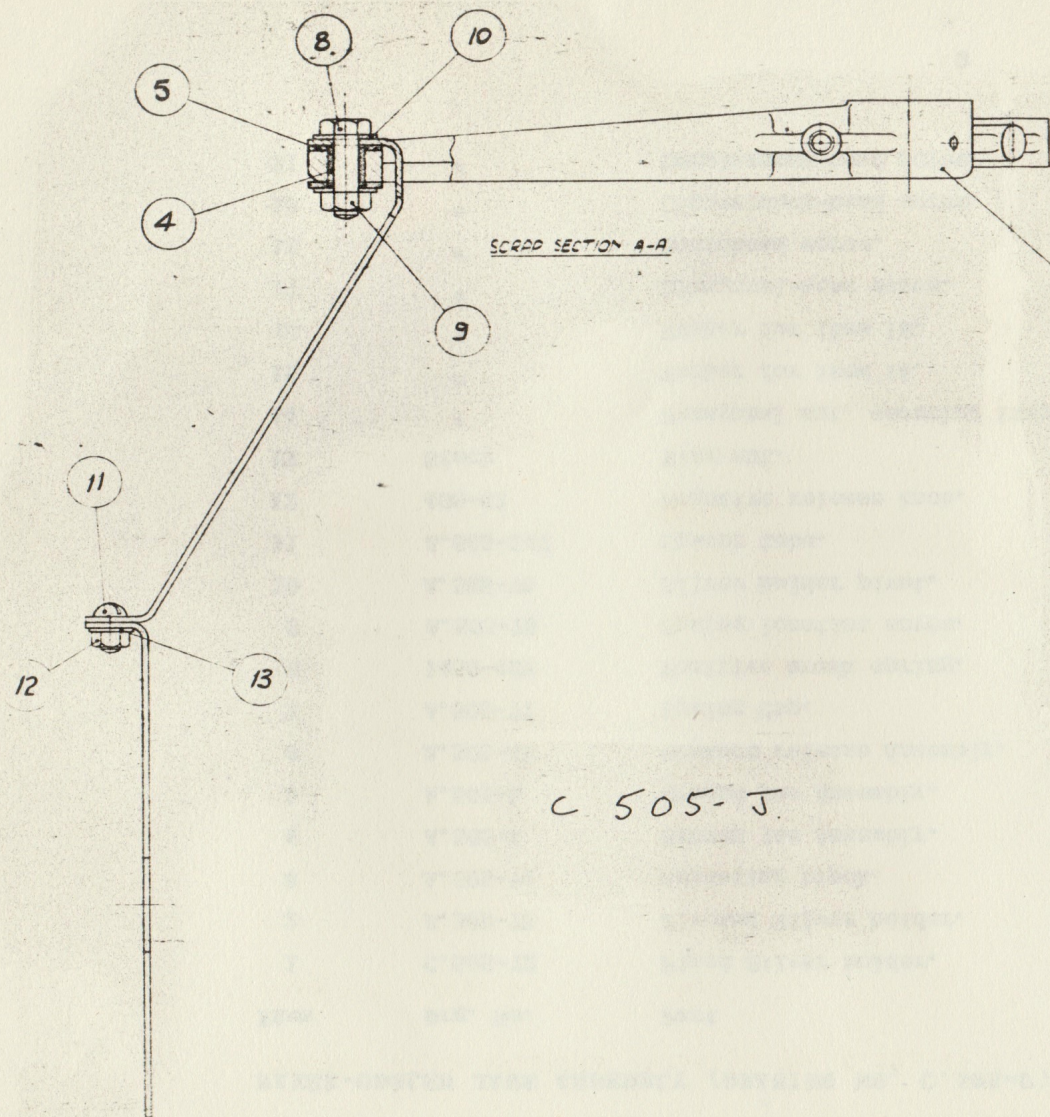


C 505-J.

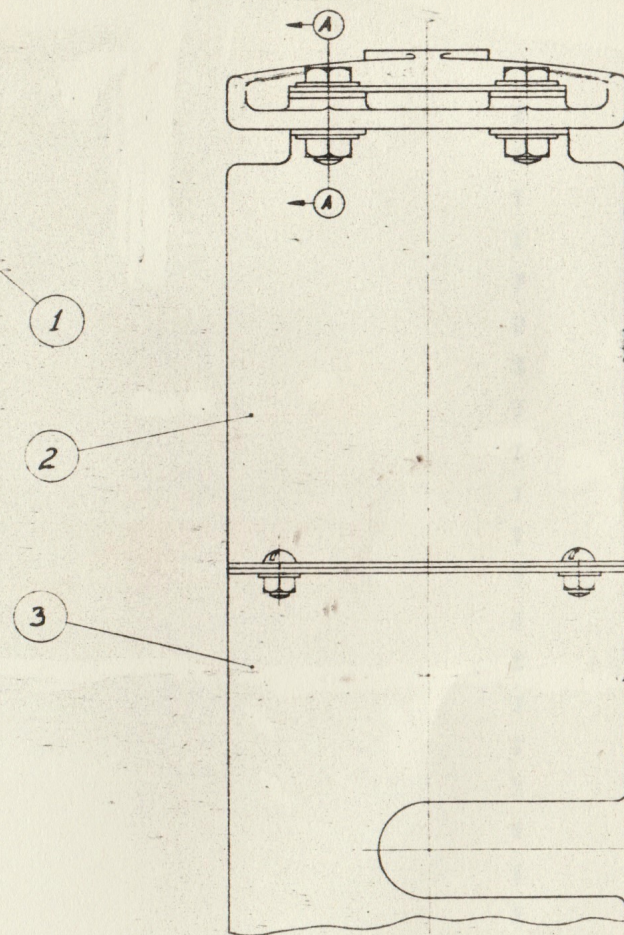

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

MIRROR GUARD ASSEMBLY (DRAWING NO. C.505-J)

Item	Drg. No.	Part	Quantity
1	C.505-85	Mirror Guard Frame.	1
2	C.505-67	Flame Deflector.	1
3	B.505-68	Mirror guard plate.	1
4	90-31-E	Insulation Bushing.	2
5	65-34-B	Mica Washer.	4
8	Stock	Hexagon-head Bolt.	2
9	"	Nut.	2
10	"	Plain washer.	4
11	"	Roundhead screw.	2
12	"	Nut.	2
13	"	Shakeproof washer (int.).	2

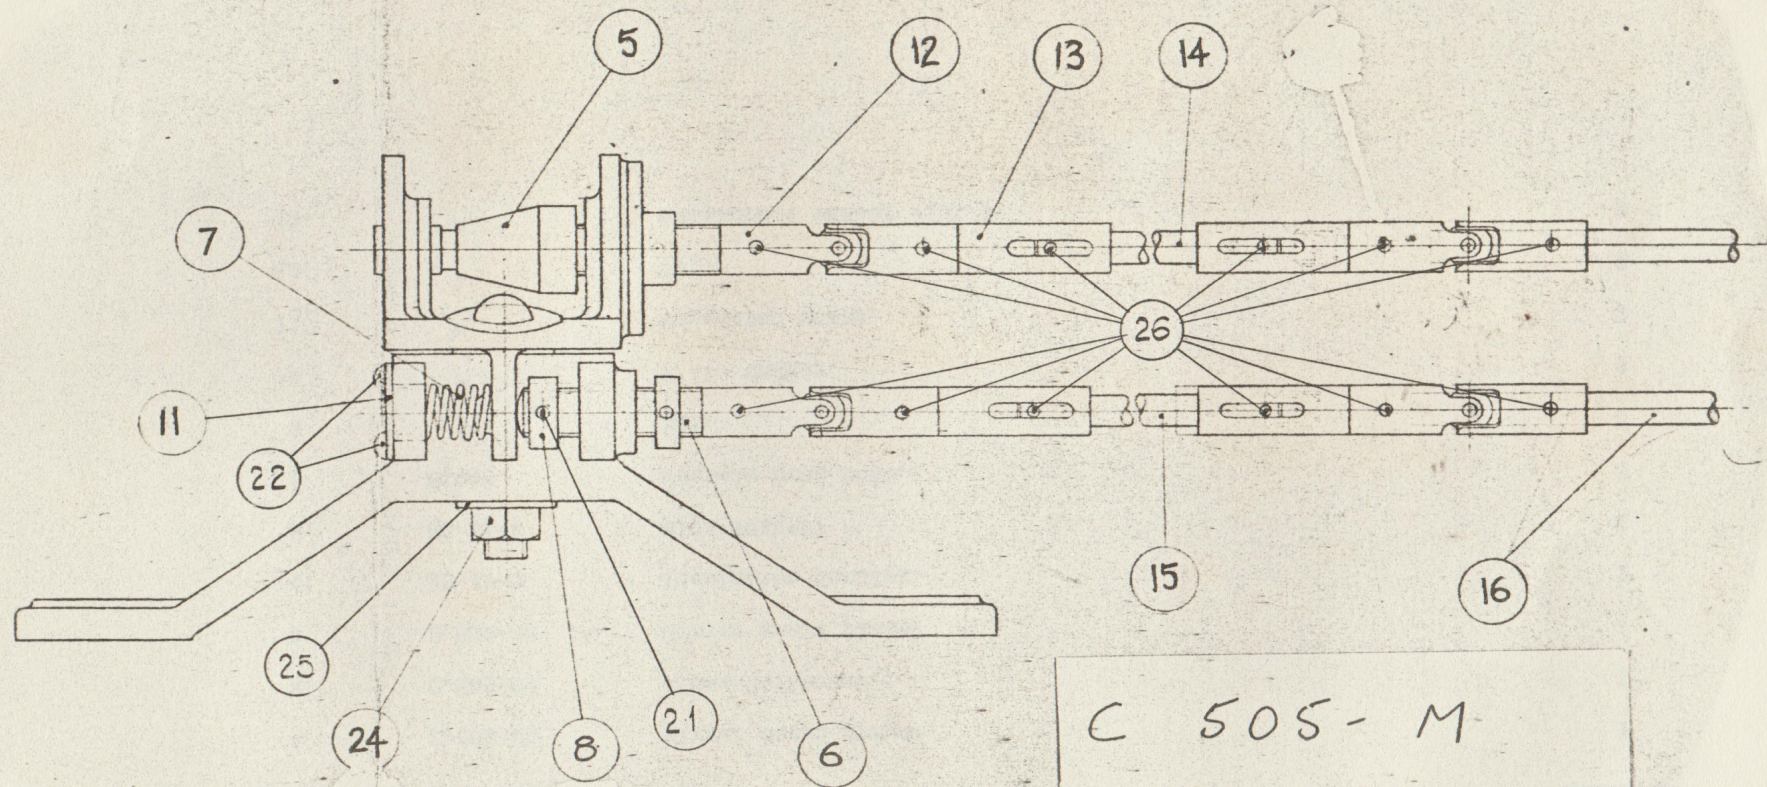


C 505-M
SECTION I

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

NEGATIVE HEAD MOUNTING UNIT (DRAWING NO. C.505-M, SECTION 1)

Item	Drg. No.	Part	Quantity
6	A.505-90	Panning Screw.	1
7	65-14	Spring.	1
8	490-133	Screwed collar.	2
11	A.505-172	Retaining Plate.	1
12	490-430	Standage Coupling.	4
13	490-427	Connecting bush.	4
14	A.505-115	Tilt adjustment link.	1
15	A.505-114	Transverse adjustment link.	1
16	A.505-116	Knob spindle.	2
21	Stock	Grubscrew.	2
22	"	Roundhead screw.	2
24	"	Nut.	1
25	"	Washer.	1
26	"	Groove pins.	12

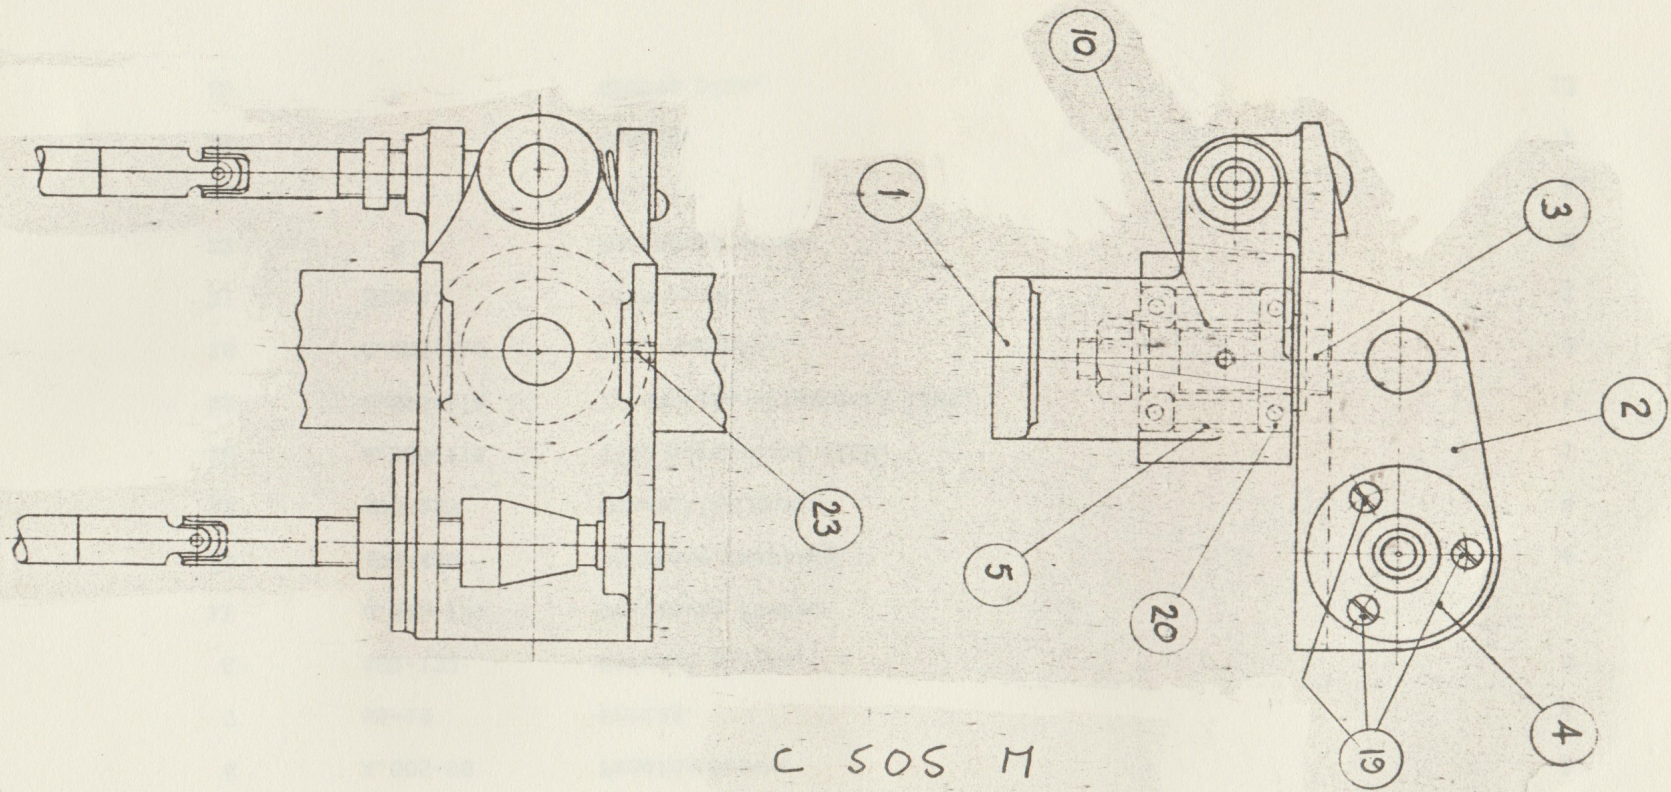


C 505 M

SECTION II

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

NEGATIVE HEAD MOUNTING UNIT (DRAWING NO. C.505-M, SECTION 2)

Item	Drg. No.	Part	Quantity
1	C.505-3	Negative Head Mounting casting.	1
2	B.505-4	Negative Tilt Frame.	1
3	490-131	Pivot spindle, (vertical).	1
4	490-132	Bearing bush.	1
5	490-69	Lifting Cone.	1
9	490-90	Bearing spacer, (outer).	1
10	490-89	Bearing spacer, (inner).	1
19	Stock	Countersunk-head screw.	3
20	"	Bearing, (K.L.N.J. $\frac{1}{2}$ ").	2
23	"	Grubscrew.	1

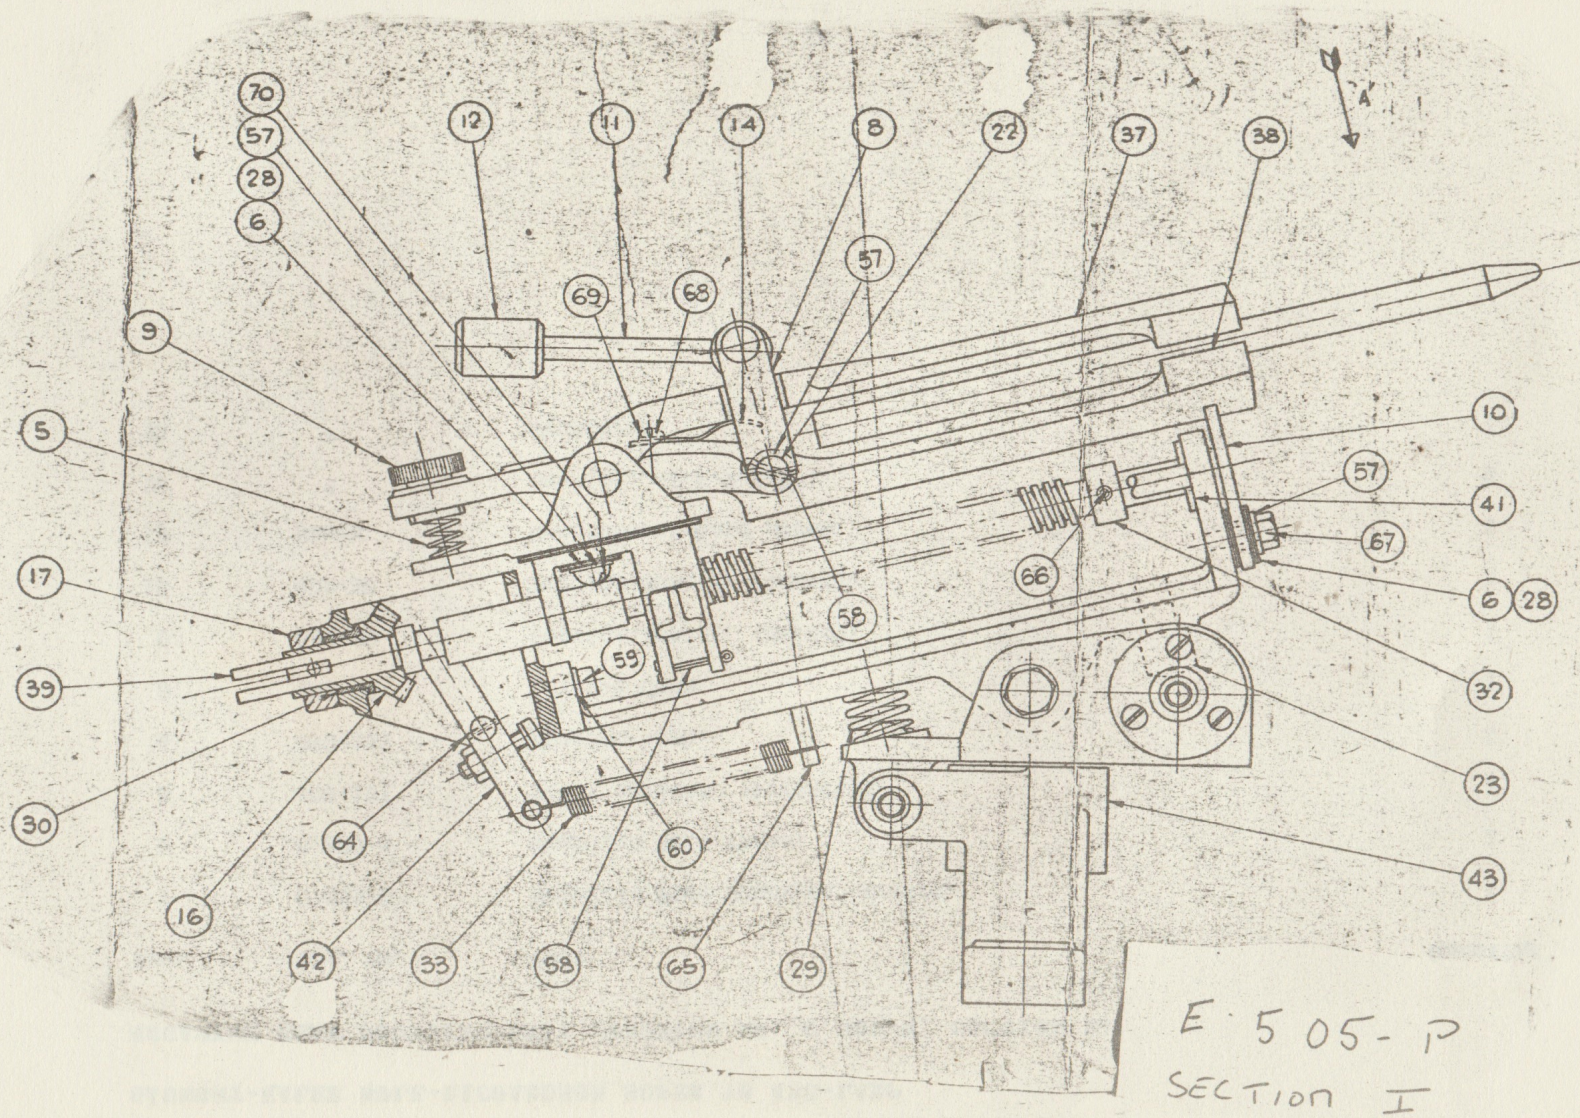


E 5 05- P
SECTION I

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

DRAWING NUMBER E.505-P, SECTION 1, NEGATIVE HEAD ASSEMBLY


Item	Drg. No.	Part	Quantity
5	490-163	Friction Spring.	1
6	90-31-D	Insulation Bushing.	6
8	490-55	Cam Link.	2
9	490-57	Screwed Bush.	1
10	490-58	Carbon Holder guide.	1
11	490-61	Release Cam Assembly.	1
12	490-62	Negative Release Knob.	1
14	490-64	Leaf Spring.	1
16	490-76	Lead Screw Bevel Gear.	1
17	490-68	Bush-drive Pin.	1
22	490-214	Cam Link Spindle.	1
23	490-216	Elevating Pin.	1
28	490-250	Insulation Bush.	4
29	490-252	Elevation Spring.	1
30	490-255	Oilite Bush.	1
32	490-300	Negative Feed Stop.	1
33	490-82	Striker Return Spring.	1
37	B.505-82	Upper Carbon Grip.	1
38	B.505-83	Lower Carbon Grip.	1
39	B.505-84	Negative Feed Screw.	1
41	A.505-97	Flanged Bush.	1
42	A.505-N	Arc Striker Lever Assembly.	1
43	C.505-M	Negative Head Mounting Unit.	1
57	Stock	Plain washer.	5
58	"	Split Pin.	4
59	"	Allen Screw.	2
60	"	Shakeproof washer.	4
64	"	Groove Pin.	1
65	"	Groove Pin.	1
66	"	Grubscrew.	1
67	"	Hexagon-head setscrew.	2
68	"	Roundhead Screw.	1
69	"	Shakeproof Washer.	1
70	"	Roundhead Screw.	2

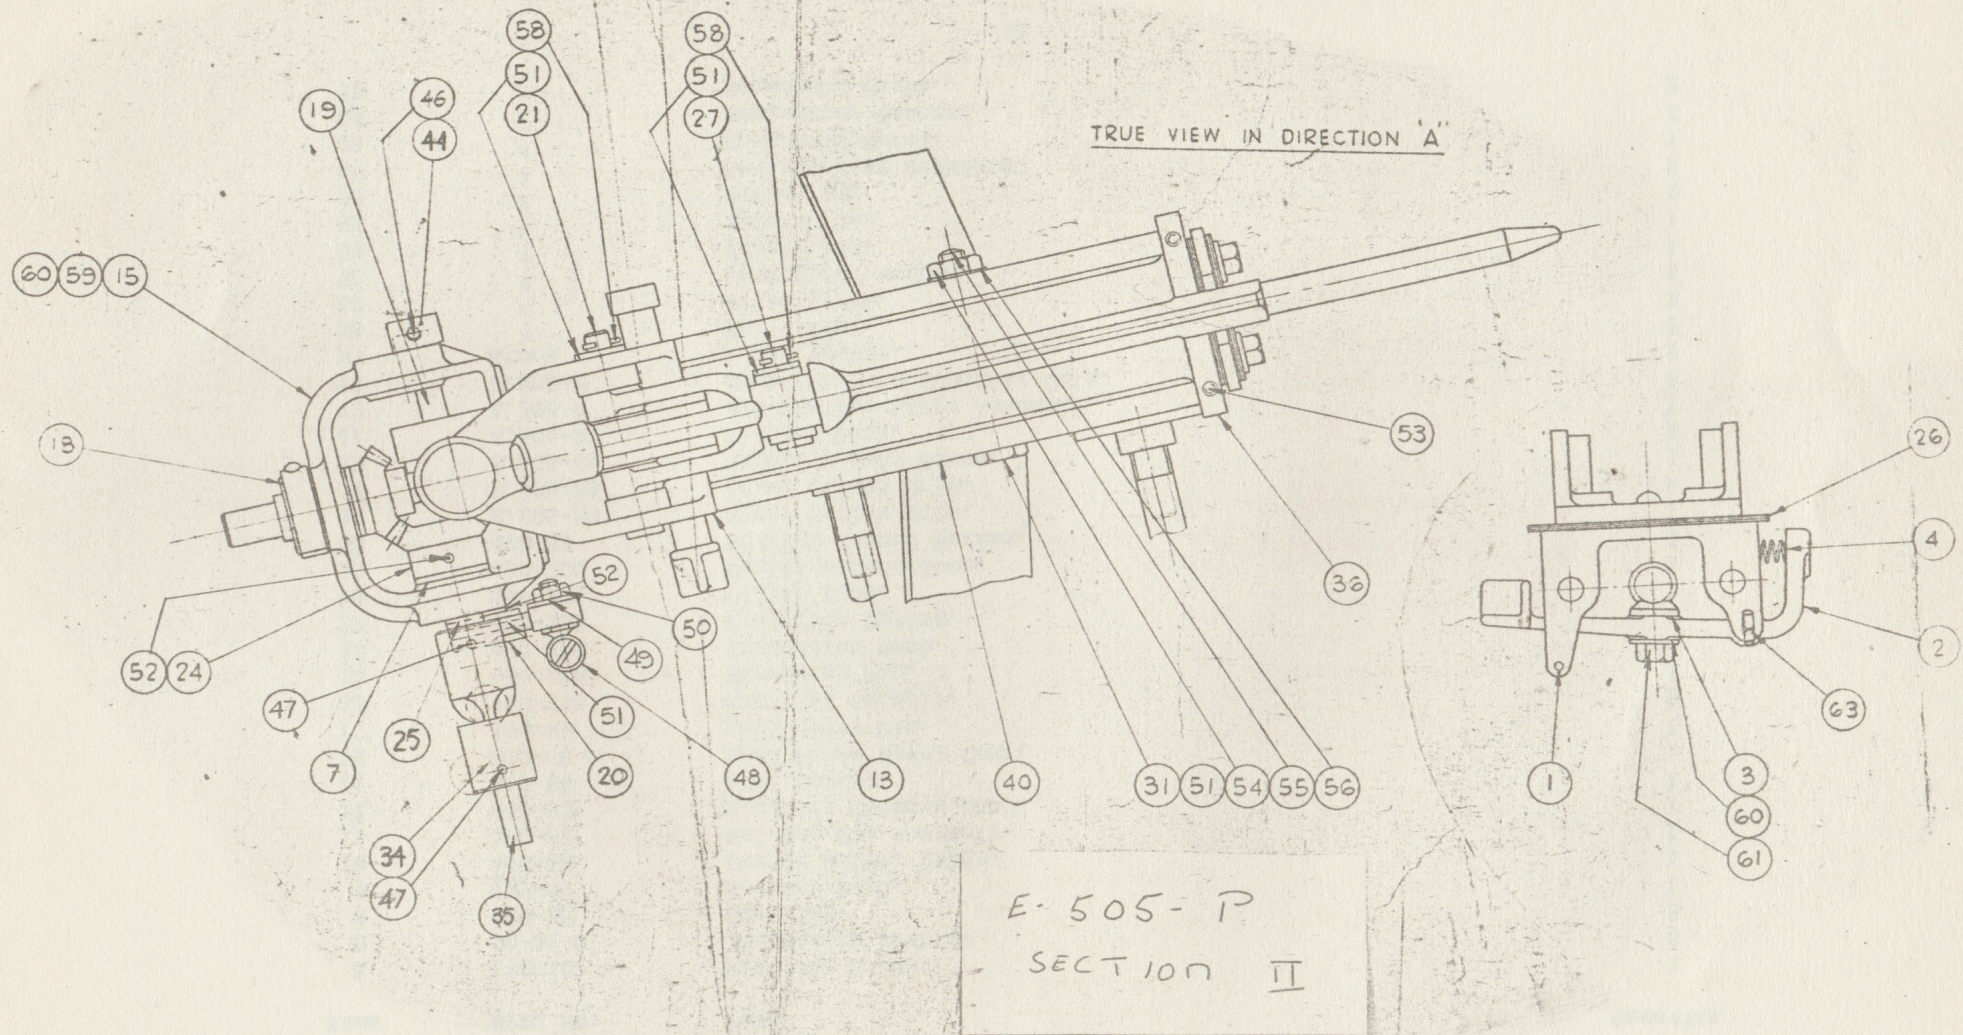

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

NEGATIVE HEAD ASSEMBLY, (DRAWING NO. E.505-P, SECTION 2)


Item	Drg. No.	Part	Quantity	Item	Drg. No.	Part	Quantity
1	60-3	Negative Carriage.	1	40	A.505-91	Negative Guide Rod.	2
2	60-6	Negative Detent Lever.	1	44	490-78	Collar.	1
3	60-16	Negative Detent Stud.	1	46	Stock	Grubscrew securing item 44.	1
4	60-17	Detent Spring.	1	47	"	Groove pin securing item 34.	2
7	450-425	Oilite Bush.	1	48	"	Balljoint.	1
13	490-63	Negative Carbon Bracket.	1	49	"	Shakeproof washer.	1
15	490-65	Negative carriage Gear-box.	1	50	"	Hexagonal Nut.	1
18	490-71	Negative Drive Pin Assembly.	1	51	"	Plain washer.	5
19	A.490-77	Arc Striker Spindle.	1	52	"	Groove Pin.	2
20	490-617	Bell Crank Striker Control.	1	53	"	Grubscrew.	2
21	490-213	Carbon Grip Spindle.	1	54	"	Hexagon-head Bolt.	1
24	490-217	Bevel Gear.	1	55	"	Hexagon nut.	1
25	490-218	Bevel Gear Shaft.	1	56	"	Shakeproof washer.	1
26	490-219	Insulating Plate.	1	58	"	Split Pin.	4
27	490-246	Upper Cam Link.	1	59	"	Allen Screw.	2
31	490-256	Negative Head Pivot Shaft.	1	60	"	Shakeproof washer.	4
34	490-211-B	Mollart Balljoint.	1	61	"	Hexagon Nut.	1
35	490-505	Sliding Shaft.	1	62	"	Roundhead Rivet.	1
36	C.505-81	Negative Main Frame.	1	63	"	Split Pin.	1

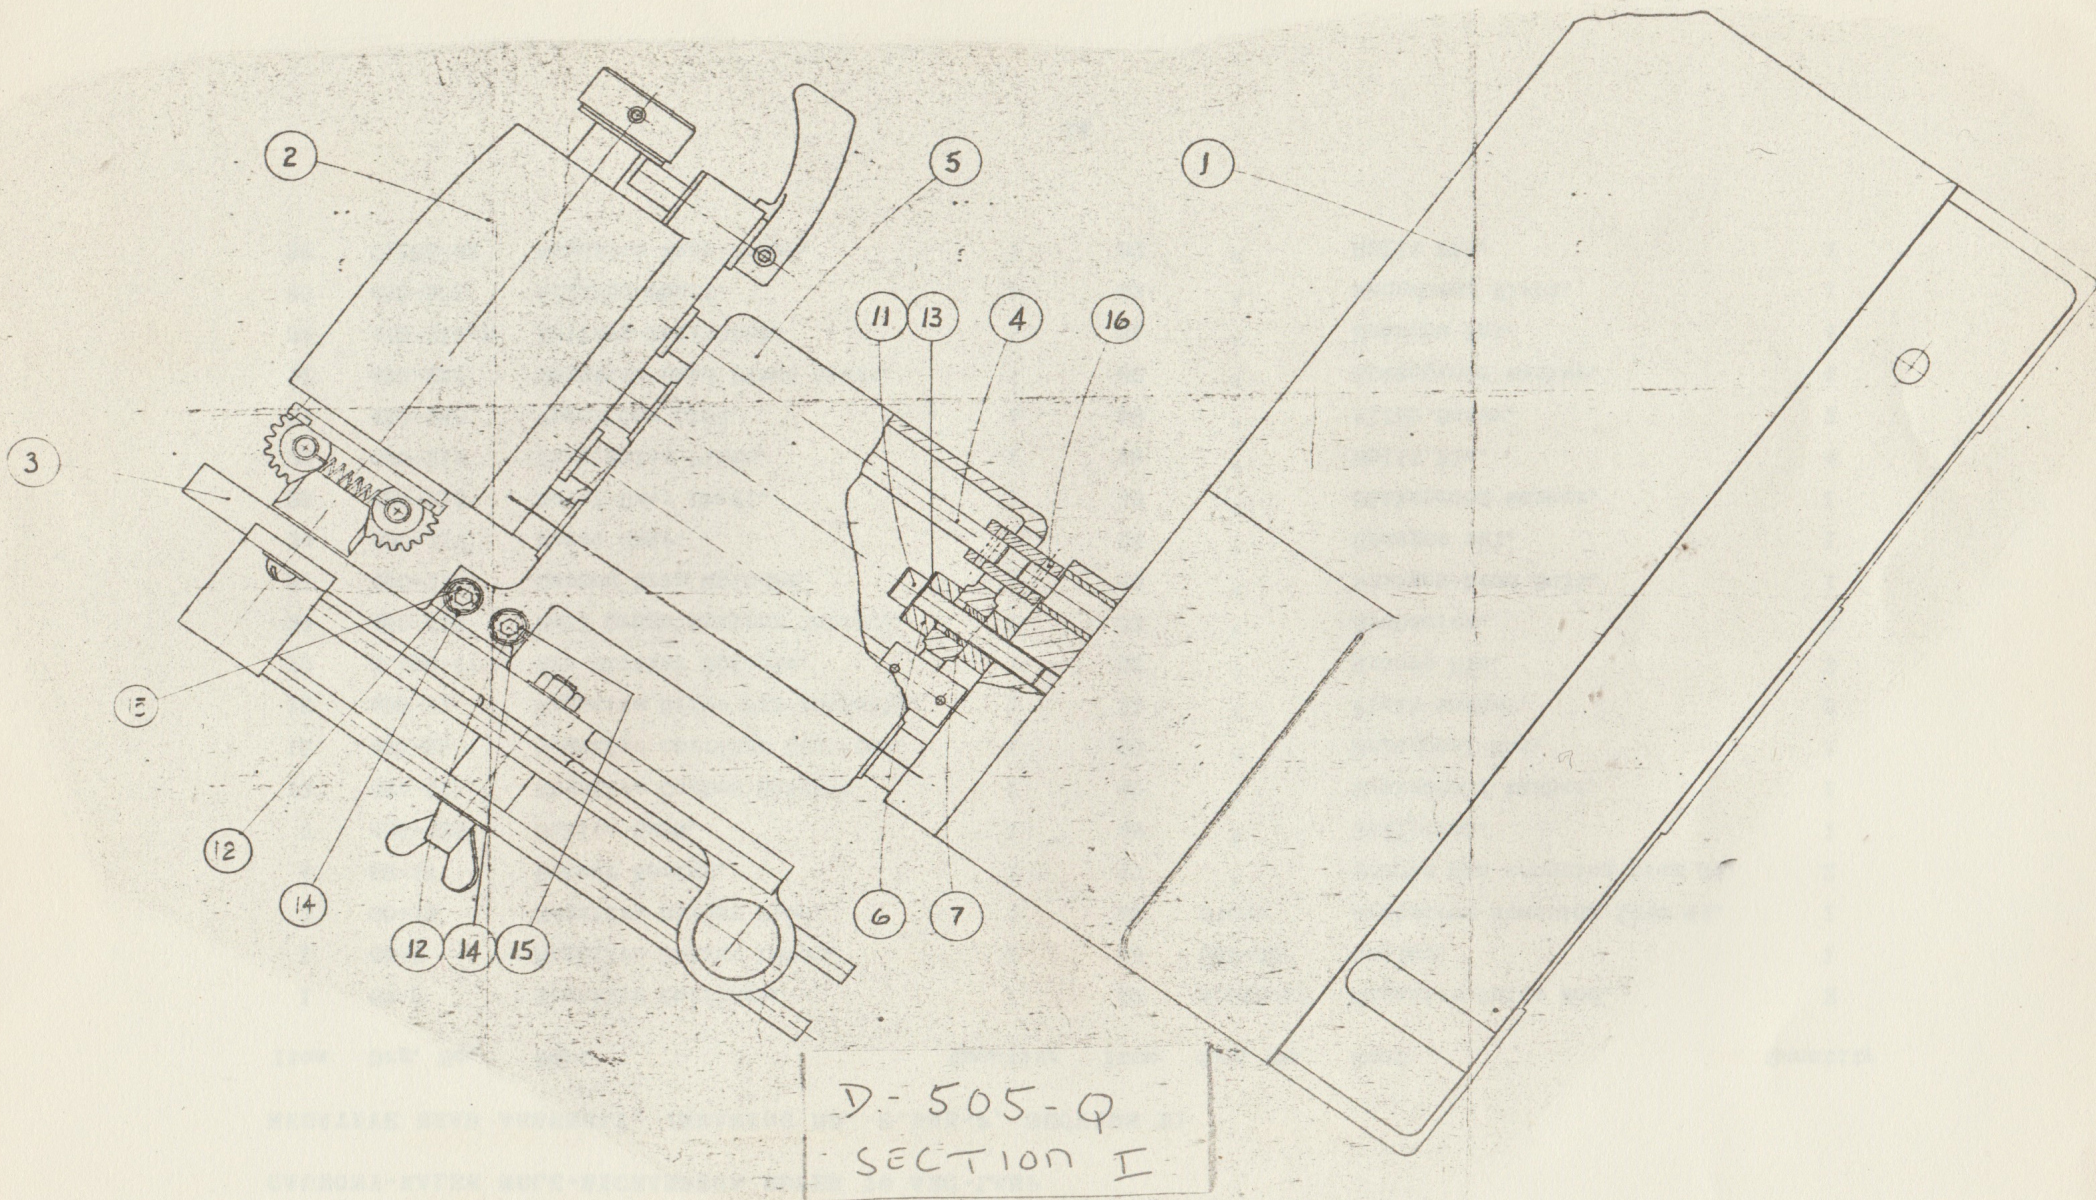

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

POSITIVE MECHANISM ASSEMBLY, (DRAWING NO. D.505-Q, SECTION 1)

Item	Drg. No.	Part	Quantity
1	E.505-E	Drive motor box Assembly.	1
2	C.505-B	Positive Head Assembly.	1
3	C.505-F	Water-cooling Jaws Assembly.	1
4	A.505-R	Connecting drive rod Assembly.	2
5	C.505-39	Positive head mounting casting.	1
6	A.505-34	Insulation washer.	8
7	A.505-35	Insulation bush.	4
11	Stock	Socket-head cap-screw.	4
12	"	Socket-head cap-screw.	2
13	"	Plain washer.	4
14	"	Shakeproof washer.	4
15	"	Hexagon nut.	2
16	"	Groove Pin.	2

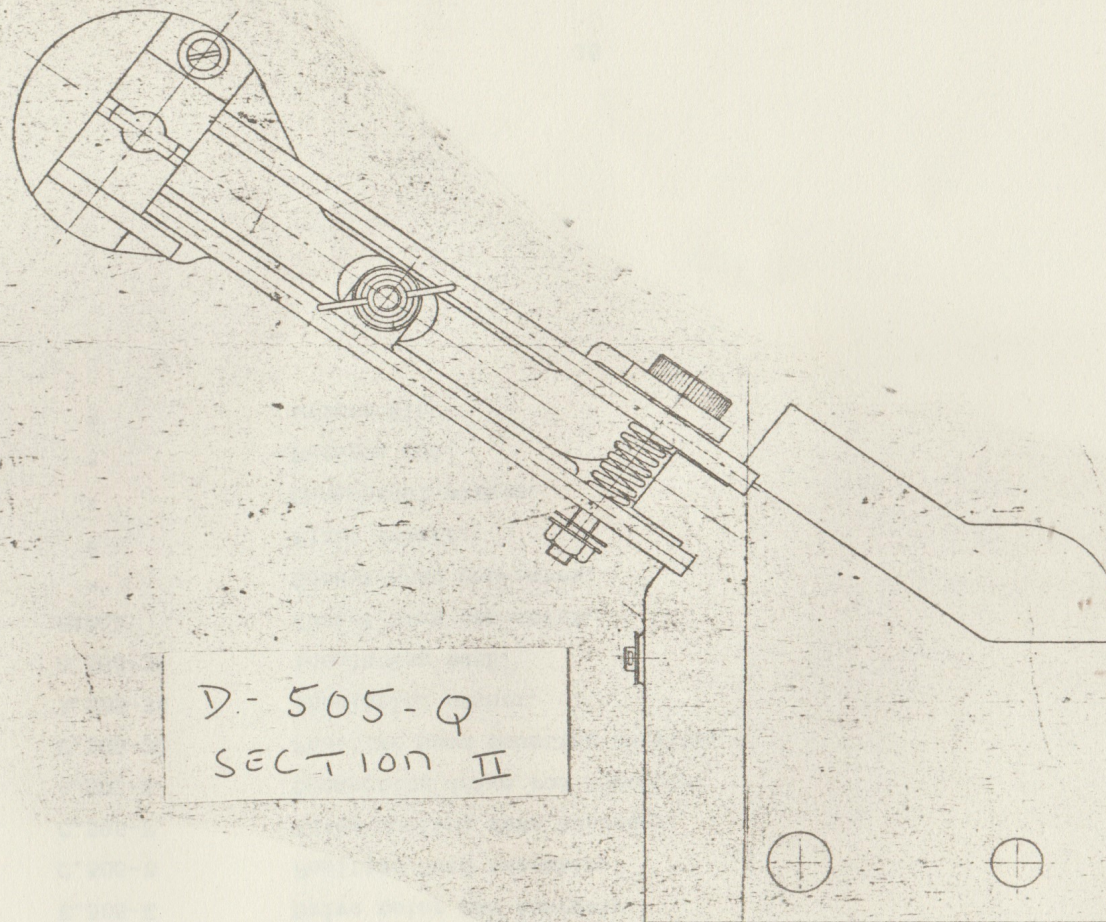


D-505-Q
SECTION II


GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

POSITIVE MECHANISM ASSEMBLY, (DRAWING NO. D.505-Q, SECTION 2)

Item	Drg. No.	Part	Quantity
1	E.505-E	Drive motor box Assembly.	1
2	C.505-B	Positive Head Assembly.	1
3	C.505-F	Water-cooling Jaws Assembly.	1
4	A.505-R	Connecting drive rod Assembly.	2
5	C.505-39	Positive head mounting casting.	1
6	A.505-34	Insulation washer.	8
7	A.505-35	Insulation bush.	4
11	Stock	Socket-head cap-screw.	4
12	"	Socket-head cap-screw.	2
13	"	Plain washer.	4
14	"	Shakeproof washer.	4
15	"	Hexagon nut.	2
16	"	Groove Pin.	2

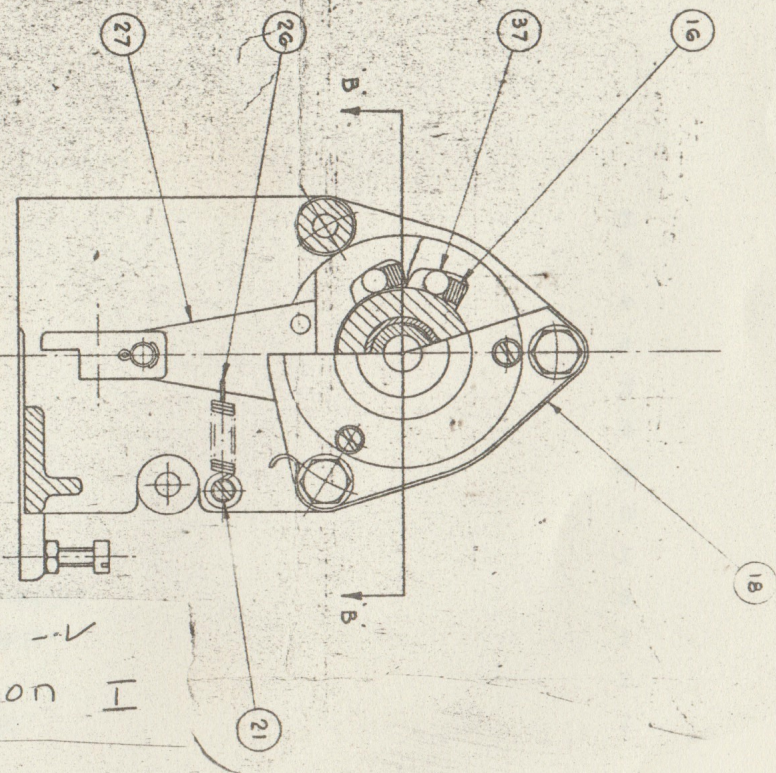

PART SECTION A-A

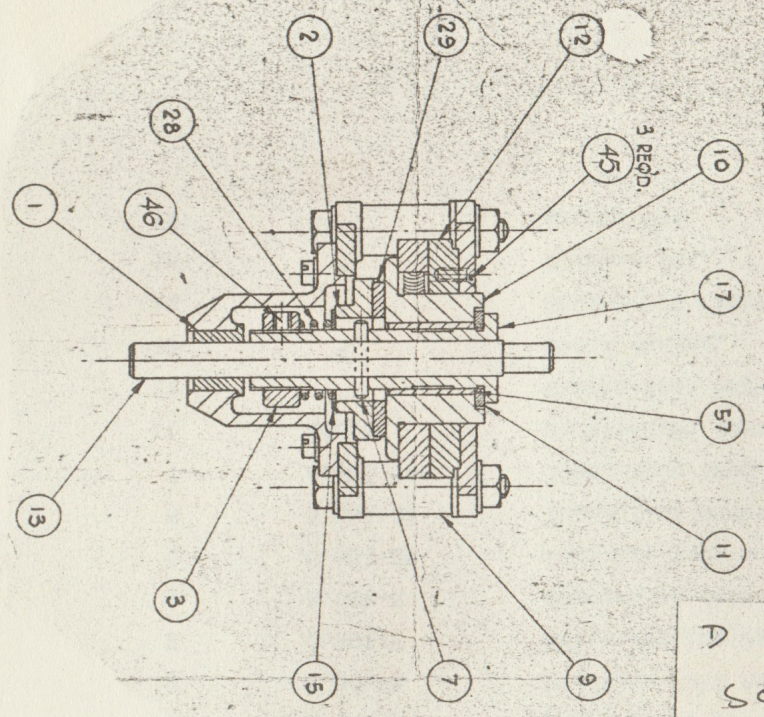


D 505 -V
SECTION I

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

NEGATIVE DRIVE & STRIKER ASSEMBLY (DRAWING NO. D.505-V, SECTION 1)

Item	Drg. No.	Part	Quantity
1	450-525	Flanged Bearing.	1
2	490-42	Clutch Plate.	1
3	490-49	Clutch Adjusting-nut.	1
7	490-182	Clutch Pin.	1
9	490-186	Support Pillar.	3
10	490-187	Negative Drive Bush.	1
11	490-190	Washer.	1
12	490-192	Locking disc.	1
13	490-194	Negative Hand-feed Shaft.	1
15	490-212-B	Thrust Washer.	1
16	490-253	Roller Spring.	2
17	490-254	Clutch Core.	1
18	490-264	Spring Cover.	1
21	A.505-104	Spring Pillar.	1
26	A.505-112	Spring.	1
27	B.505-W	Drive disc Assembly.	1
28	1450-446A	Negative Clutch Spring.	1
29	1450-725	Friction Disc.	1
37	Stock	Roller Bearing.	2
45	"	Countersunk-head screw.	3
46	"	Grubscrew.	1
57	"	Oilite Bush.	1

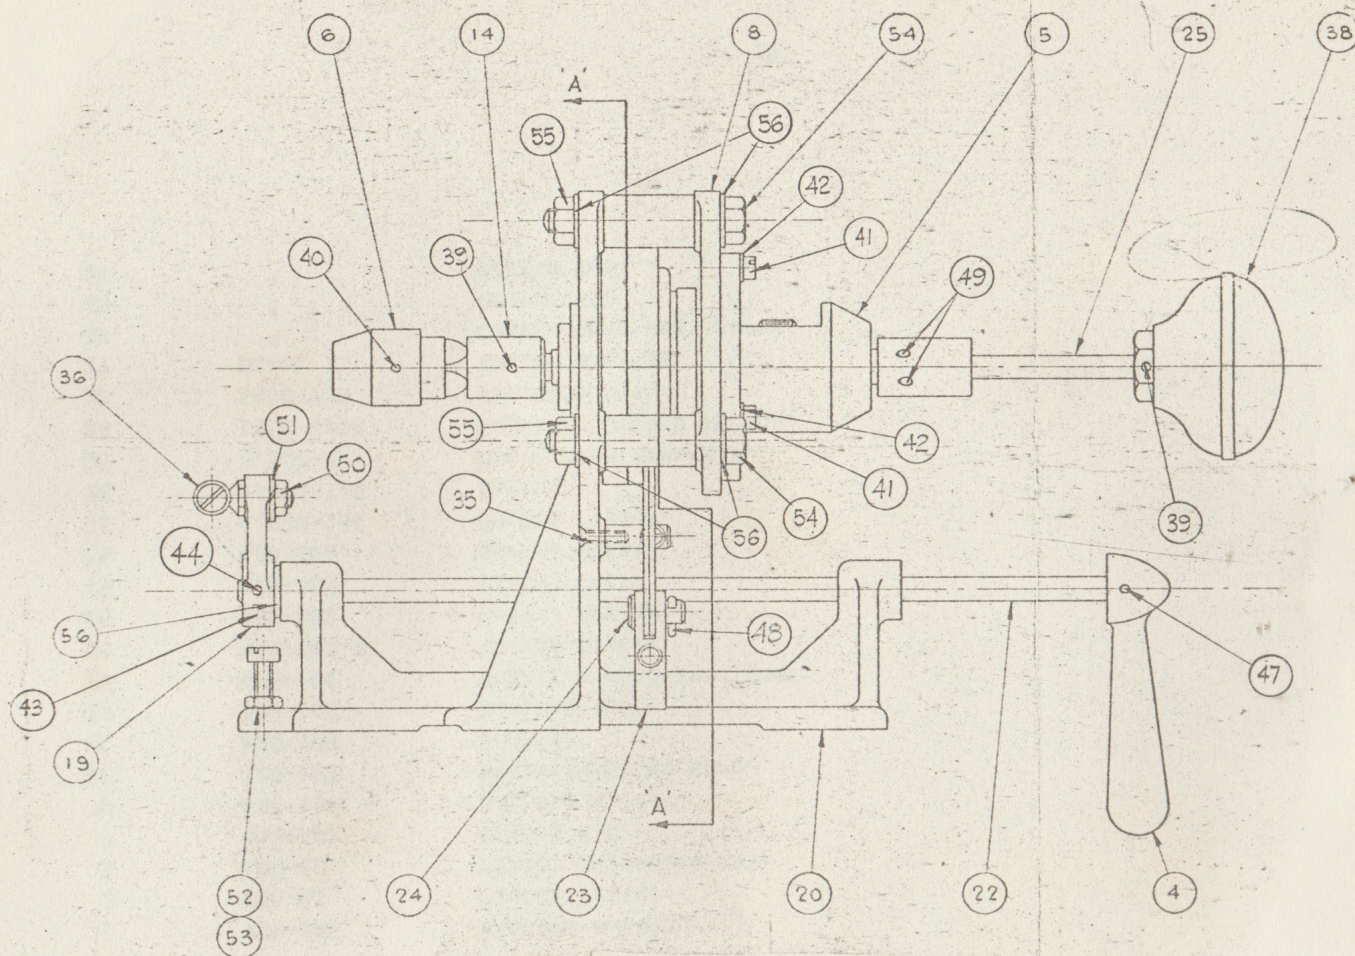


D 505 - V
SECTION II

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

NEGATIVE DRIVE & STRIKER ASSEMBLY (DRAWING NO. D.505-V, SECTION 2)

Item	Drg. No.	Part	Quantity
4	490-75	Operating Lever.	1
5	490-171	Negative Clutch housing.	1
6	490-173	Coupling Bush.	1
8	490-184	Front Plate.	1
14	490-211-C	Negative drive Universal joint.	1
19	490-617	Bell-crank striker control.	1
20	C.505-58	Negative Drive clutch mounting casting.	1
22	A.505-107	Striker Shaft.	1
23	A.505-109	Negative Drive link.	1
24	A.505-110	Pin.	1
25	A.505-11	Knob shaft.	1
35	Stock	Countersunk-head screw.	1
36	"	Balljoint.	1
38	"	Knob.	1
39	"	Groove pin.	1
40	"	Groove pin.	1
41	"	Countersunk-head screw.	3
42	"	Plain washer.	3
43	"	Grubscrew.	1
44	"	Groove Pin.	1
47	"	Grubscrew.	1
48	"	Split pin.	1
49	"	Grubscrew.	2
50	"	Hexagon nut.	1
51	"	Spring washer.	1
52	"	Countersunk-head screw.	1
53	"	Lock nut.	1
54	"	Hexagon-head Bolt.	3
55	"	Hexagon Nut.	3
56	"	Plain washer.	4

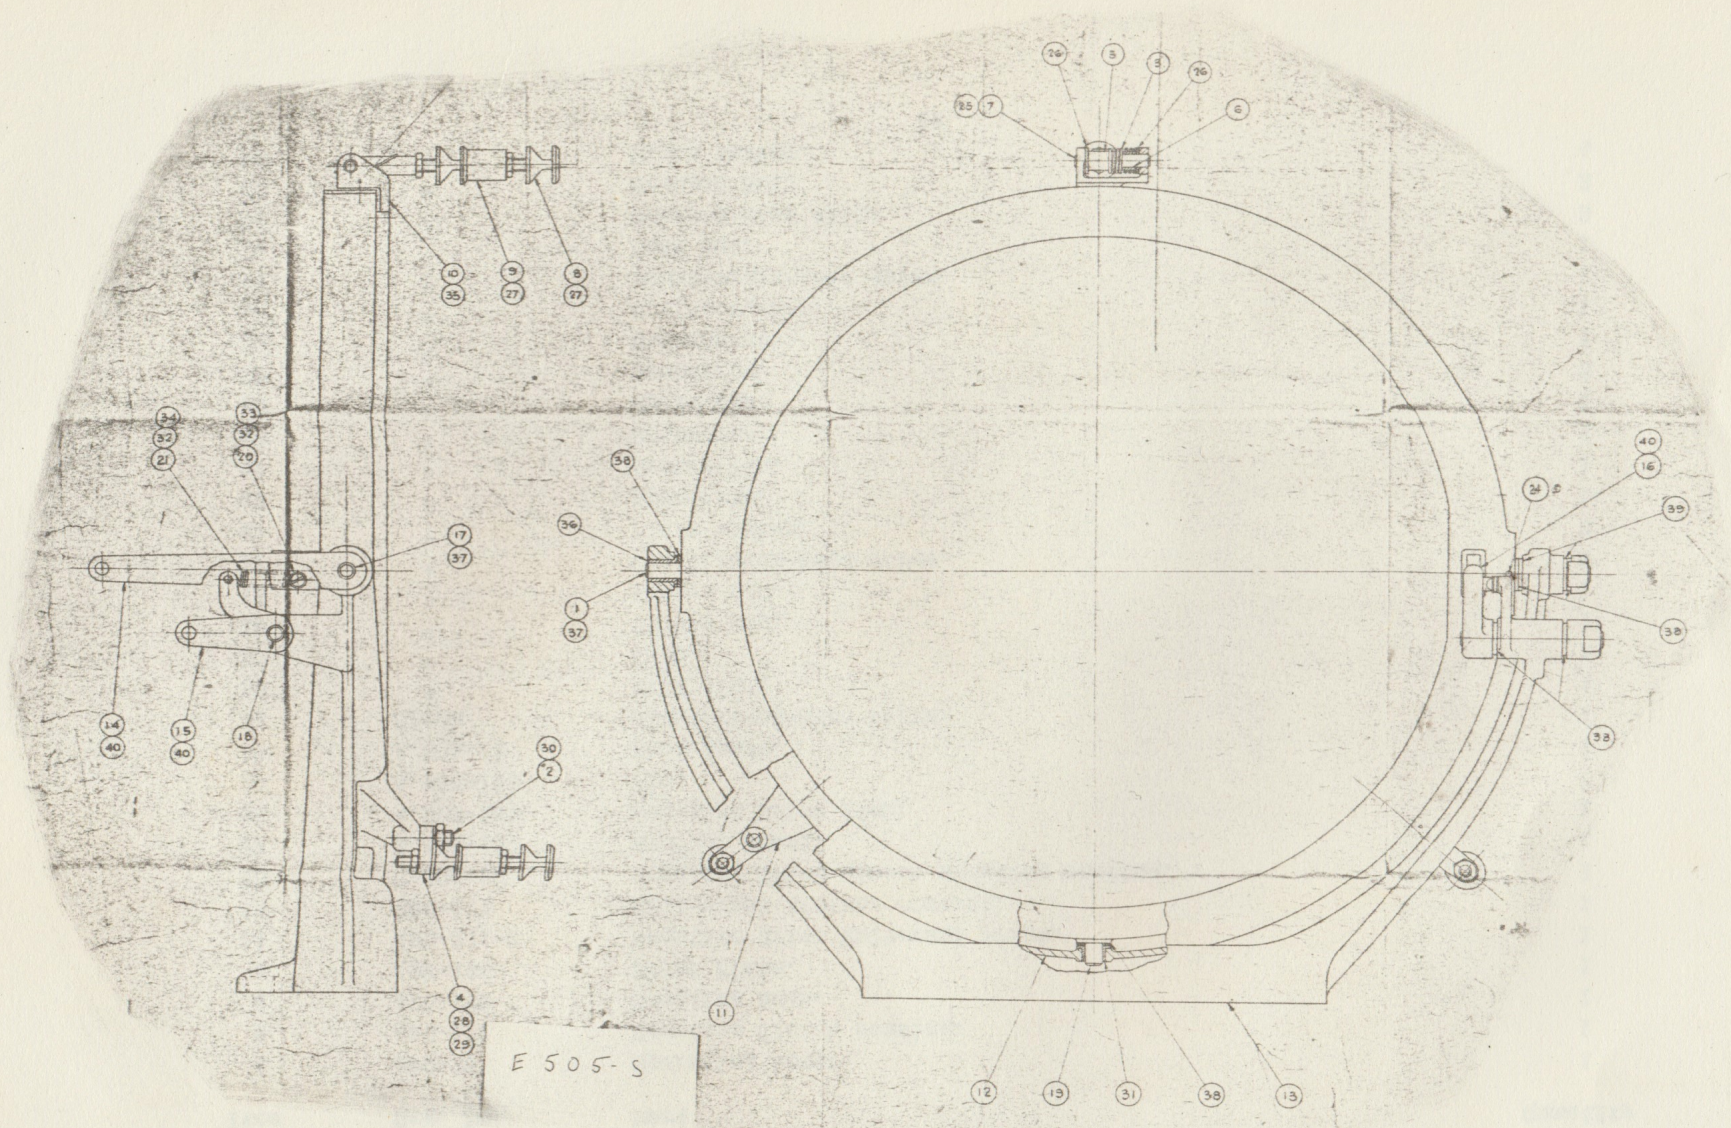


E 505-S


GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

MIRROR SUPPORT ASSEMBLY (DRAWING NO E.505-S)

Item	Drg. No.	Part	Quantity	Item	Drg. No.	Part	Quantity
1	490-94	Pivot Pin.	1	20	A.505-99	Spacer.	1
2	490-122	Locking stud.	2	21	A.505-112	Spring.	1
3	490-128	Mirror clip spring.	1	24	Stock	Groove pin.	1
4	A.490-746	Bobbin link.	2	25	"	Grubscrew.	1
5	A.490-586	Mirror clip lever.	1	26	"	Plain washer.	2
6	490.S.588	Spacer	1	27	"	Locknut.	6
7	490.S.589	Mirror clip pivot.	1	28	"	Spring washer.	2
8	A.490-738	X 7 Bobbin.	3	29	"	Locknut.	2
9	A.490-739	X 6 Bobbin, (long).	3	30	"	Groove pin.	2
10	A.505-11	Mirror clip bracket.	1	31	"	Oilite bush.	2
11	D.505-14	Internal mirror ring.	1	32	"	Plain washer.	4
12	D.505-15	External mirror ring.	1	33	"	Roundhead screw.	1
13	D.505-16	Reflector support.	1	34	"	Roundhead screw.	1
14	A.505-18	Mirror tilt lever.	1	35	"	Countersunk-head screw.	2
15	A.505-19	Mirror pivot lever.	1	36	"	Oilite Bush.	1
16	A.505-21	Mirror pivot buffer.	1	37	"	Grubscrew.	1
17	A.505-25	Mirror tilt spindle.	1	38	"	Plain washer.	7
18	A.505-26	Pivot buffer spindle.	1	39	"	Oilite bush.	2
19	A.505-98	Pivot, pin-screwed.	2	40	"	Groove pin.	3

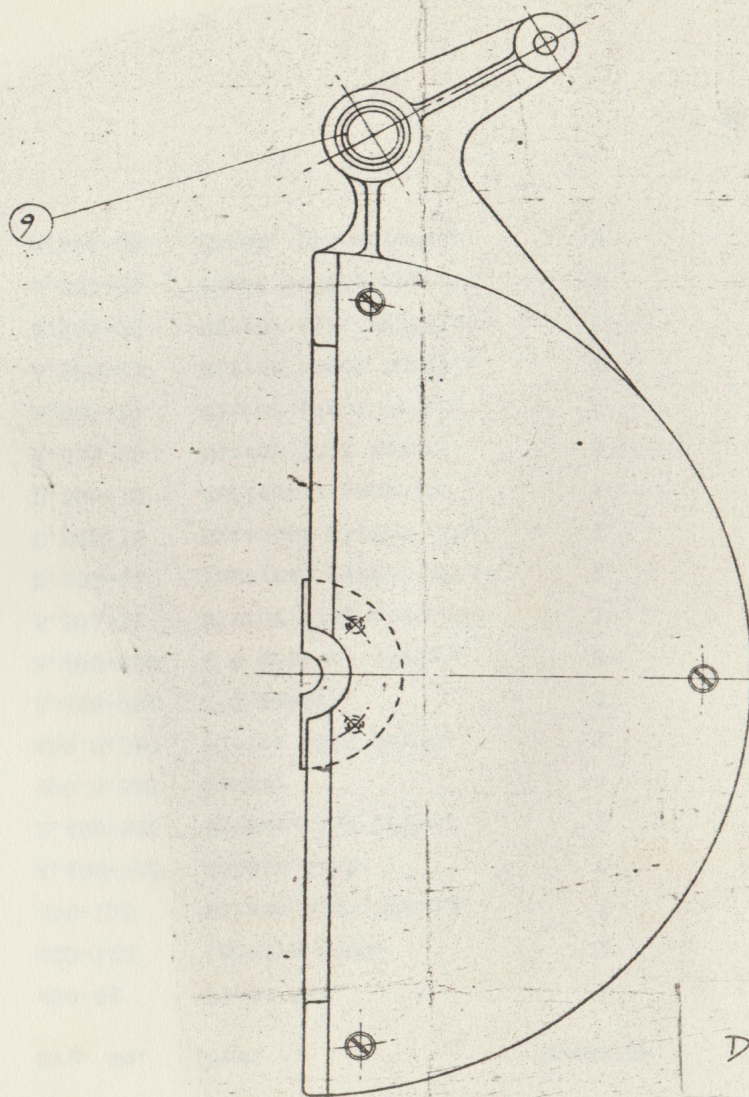


D 505-T

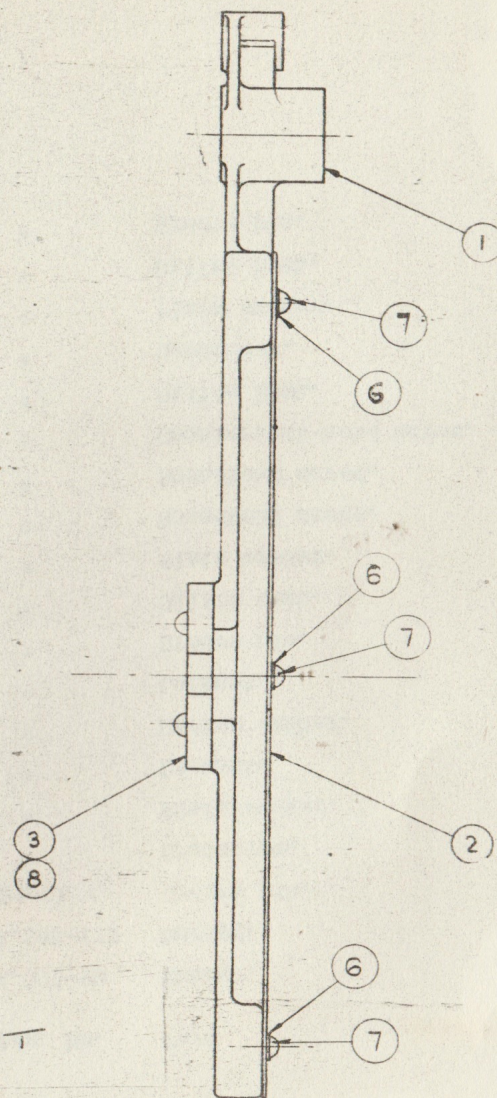


GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

DOUSER BLADE ASSEMBLY, (OFFSIDE), (DRAWING NO. D.505-T)

Item	Drg. No.	Part	Quantity
1	D.505-41	Douser blade, (offside).	1
2	C.505-51	Douser cover plate.	1
3	A.505-53	Douser blade insulator.	1
6	Stock	Shakeproof washer.	3
7	"	Roundhead screw.	3
8	"	Roundhead screw.	2
9	"	Bearing.	1

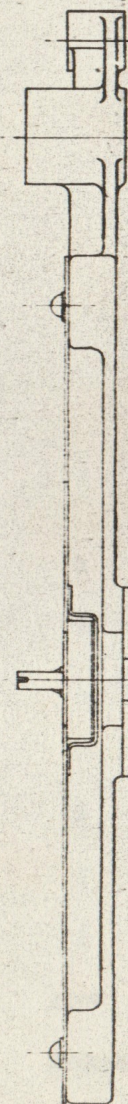

D 505 - U

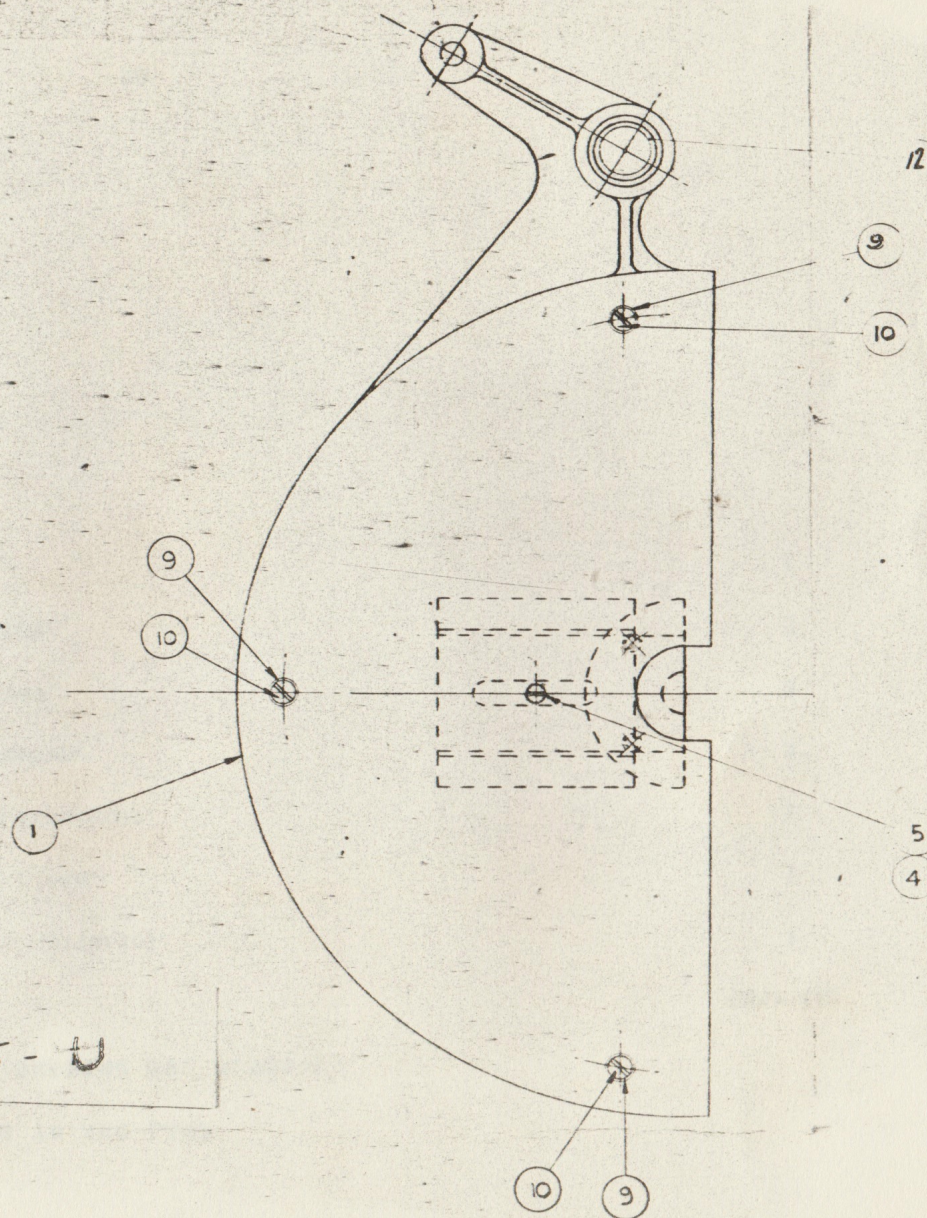

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

DOUSER BLADE ASSEMBLY, (OPERATING SIDE), (DRAWING NO.D.505-U)

Item	Drg. No.	Part	Quantity
1	D.505-40	Douser blade, (operating side).	1
2	C.505-C	Shutter guard & Douser plate Assembly.	1
3	A.505-53	Douser blade insulator.	1
4	A.505-54	Insulated shutter.	1
5	A.505-101	Shutter pin.	1
9	Stock	Shakeproof washer.	3
10	"	Roundhead screw.	3
11	"	Roundhead screw.	2
12	"	Bearing.	1

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

SHEET METAL HOUSING PARTS (DRAWING NO.505-X)

Item	Drg. No.	Part	Quantity
1	D.505-174	Outer skin, offside door.	1
2	C.505-175	Inner skin, offside door.	1
3	C.505-176	Centre skin, offside door.	1
4	D.505-177	Outer skin, operating side door.	1
5	C.505-178	Inner skin, operating side door.	1
6	C.505-179	Centre skin, operating side door.	1
7	A.505-180	Peephole spacer.	2
8	A.505-181	Peephole cover plate.	2
9	E.505-182	Outer skin.	1
10	E.505-183	Inner skin.	1
11	D.505-184	Centre skin.	1
12	C.505-198	Cooling duct.	1

GAUMONT-KALEE MOLE-RICHARDSON SUPER 70 ARC-LAMP

WATER-COOLED JAWS ASSEMBLY (DRAWING NO. C.505-F)

Item	Drg. No.	Part	Quantity
1	C.505-72	Fixed Silver holder.	1
2	B.505-73	Pivoted Silver holder.	1
3	A.505-74	Adjusting block.	1
4	A.505-K	Brazed jaw Assembly.	1
5	A.505-L	Brazed jaw Assembly.	1
6	A.505-AV	Contact release Assembly.	1
7	A.505-77	Spring Cap.	1
8	1450-469	Positive brush spring.	1
9	A.505-78	Spring location screw.	1
10	A.505-76	Silver holder pivot.	1
11	A.505-147	Spacer tube.	1
12	490-62	Negative release knob.	1
13	Stock	Wing nut.	1
14	"	Hexagonal nut, securing item 10.	2
15	"	Washer for item 14.	5
16	"	Washer for item 18.	1
17	"	Hexagonal-head screw.	1
18	"	Roundhead screw.	1
20	"	Countersunk-head screw.	1
21	"	Countersunk-head screw.	1

